

General Information

Date & Time: 17, Dec, 2025 17:33

Make	Toyota	Model	Hiace
YOM	2024	Odo Meter Reading	32,034
Registration No.	NFR7451	Chassis No.	JTFNAFAP8R8042973
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



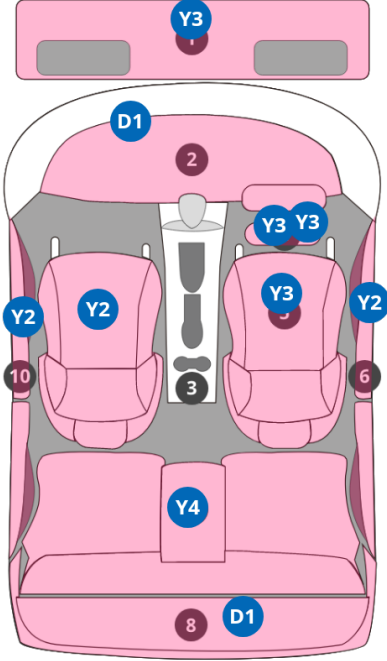
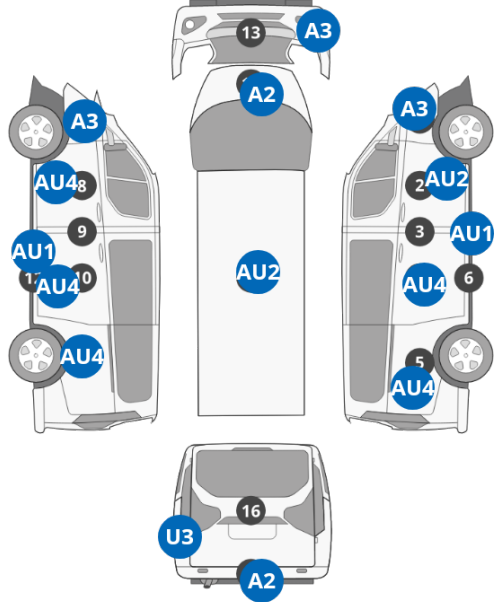
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.5	137	60	141
2	Boot Lid	108.8	80	136	110
3	Roof	97.3	88	155	80/66
4	Left Front Fender	88.8	99	61	106
5	Left Front Door	128.7	168	59	159
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	115.4	82	157	107
9	Right Front Fender	128.8	137	96	154
10	Right Front Door	95.8	67	105	116
11	Center Panel Right	119.3	208	72	78
12	Right Rear Door	160.6	69	342	71
13	Right Back Panel	98.0	63	115	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worked - Minimal / Ceiling - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / Trunk Room - Worked - Minimal / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Medium	Remarks (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with LTO plate, with manual & warranty booklet, with reverse camera, with spare tire, no spare key, no tools & jack, issue on taillight, scratches on headlight.