

General Information

Date & Time: 17, Dec, 2025 17:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	30,126
Registration No.	NHU4386	Chassis No.	PA1B18F31R4270435
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



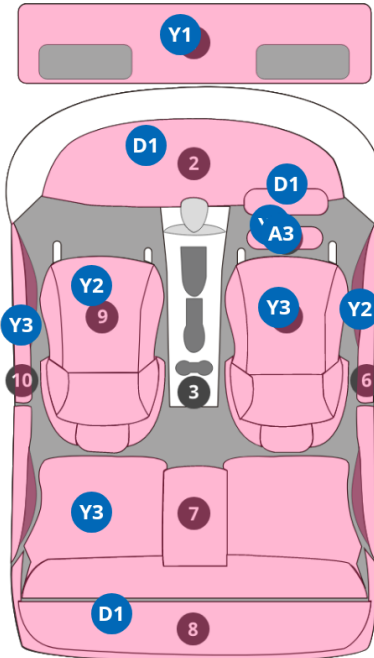
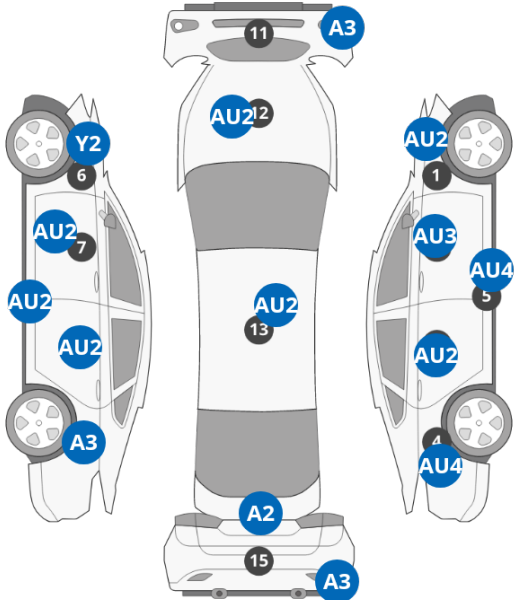
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	144.6	144	134	156
2	Boot Lid	154.3	166	168	129
3	Roof	117.0	87	59	168/154
4	Left Front Fender	147.0	148	139	154
5	Left Front Door	113.6	121	121	99
6	Center Panel Left				
7	Left Rear Door	111.1	115	62	157
8	Left Back Panel	136.3	137	126	146
9	Right Front Fender	143.3	127	158	145
10	Right Front Door	112.0	116	108	112
11	Center Panel Right				
12	Right Rear Door	142.3	154	157	116
13	Right Back Panel	146.3	144	146	149

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worked - Minimal / Glove Box - Worked - Minimal / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worked - Minimal / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / Ceiling - Grime - Minimal	Remarks (L) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Crack, Gap - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

with LTO plate, with jack, with spare key, with spare tire, with reverse camera, with manual & warranty booklet, scratches on taillight & headlight.