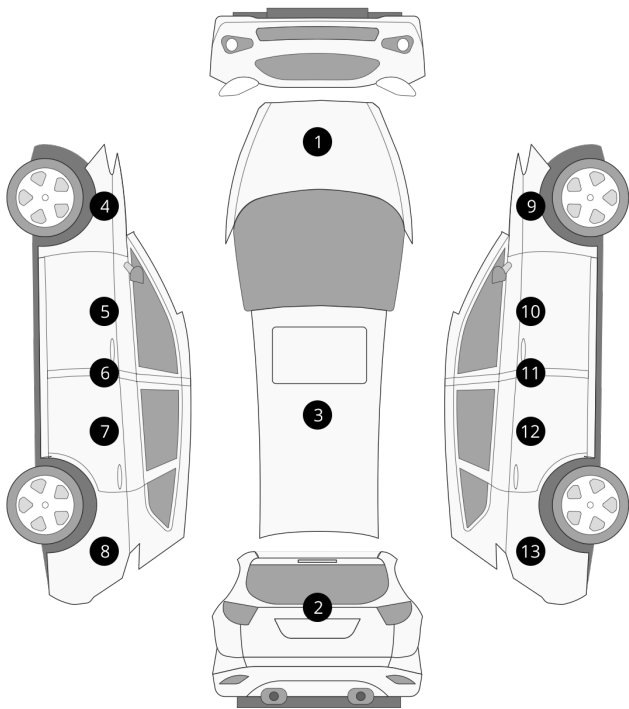


## General Information

Date & Time: 05, Jan, 2026 08:39

<b>Make</b>	Nissan	<b>Model</b>	NV350
<b>YOM</b>	2020	<b>Odo Meter Reading</b>	102,640
<b>Registration No.</b>	GAO1469	<b>Chassis No.</b>	JN1TC2E26Z0060526
<b>CC</b>	2.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	White		

## Body / Panel Condition



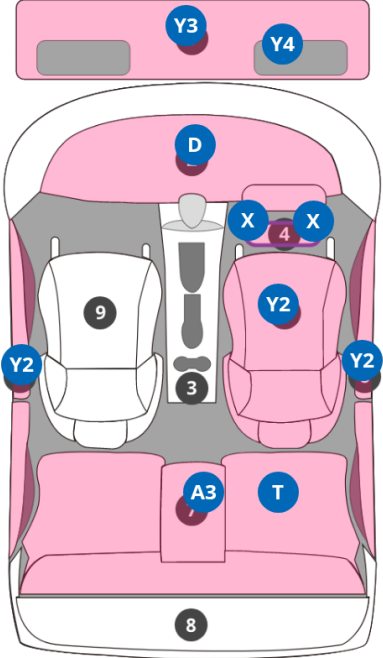
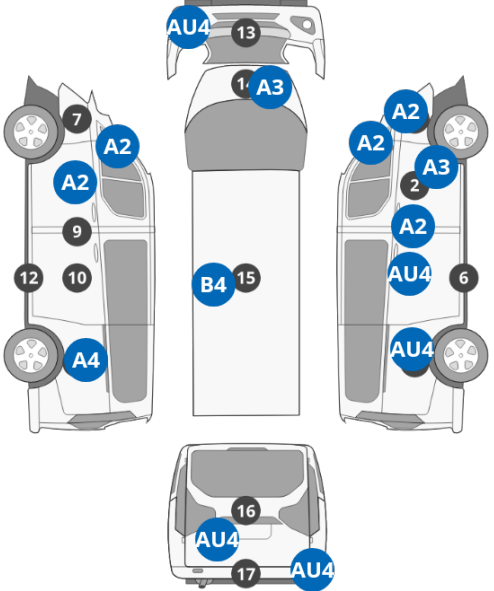
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	197.3	177	207	208
2	Boot Lid	160.6	175	167	140
3	Roof	100.0	111	104	94/92
4	Left Front Fender	210.3	234	181	216
5	Left Front Door	183.0	173	161	215
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	174.6	160	161	203
9	Right Front Fender	194.3	185	204	194
10	Right Front Door	222.0	212	191	263
11	Center Panel Right	209.3	218	222	188
12	Right Rear Door	208.6	287	182	157
13	Right Back Panel	185.0	177	169	209

**Overall Evaluation :**

**D**

**Disclaimer**

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Sunvisor, Sunglass Holder - Grime - Large / Ceiling - Grime - Medium / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Rear Seat - Cut, Crack - Medium / Rear Seat - Cigarette Burns - Burnt / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch - Large / Roof - Modified - Large / Bonnet, Headlight - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Engine oil leak issue. Check engine light. Gap at front bumper. Front right door issue. Tail light issue. No plate light. Aircon issue. Without warranty booklet, jack, tools and seat cover. With spare tire. 1 key. With LTO plate. Interior grab handle dirty.</p>