

## General Information

Date & Time: 24, Feb, 2026 15:24

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	65,749
<b>Registration No.</b>	FAJ4456	<b>Chassis No.</b>	PA1B18F38N4177129
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



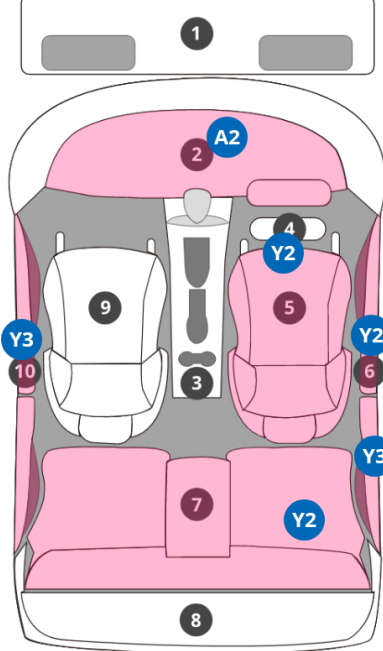
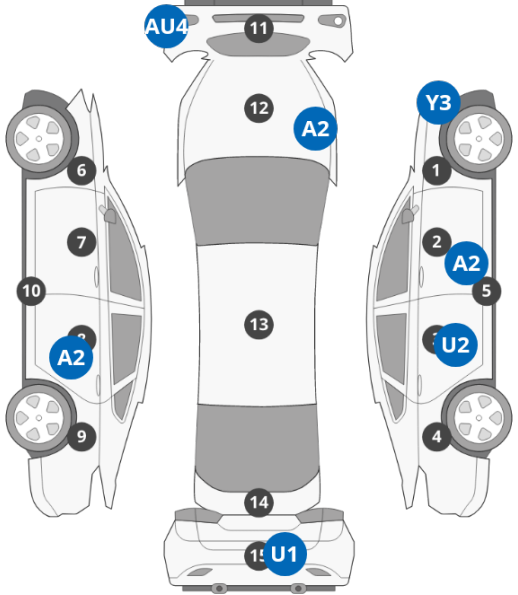
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.1	99	101	100
2	Boot Lid	91.6	98	86	91
3	Roof	83.1	84	83	81/84
4	Left Front Fender	91.5	90	90	95
5	Left Front Door	92.0	86	101	89
6	Center Panel Left				
7	Left Rear Door	93.0	95	95	90
8	Left Back Panel	92.5	97	95	86
9	Right Front Fender	90.2	90	93	88
10	Right Front Door	117.8	167	96	90
11	Center Panel Right				
12	Right Rear Door	472.3	244	741	432
13	Right Back Panel	94.5	95	91	98

**Overall Evaluation :**

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Dent - Small / Trunk Hood, Rear Gate - Dent - Minimal / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>No Spare keys. With Spare Tire. With Jack and tools. Low battery. No seat cover</p>