

General Information

Date & Time: 05, Jan, 2026 18:08

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	15,288
Registration No.	DBP9517	Chassis No.	PA1B18F30R4265940
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



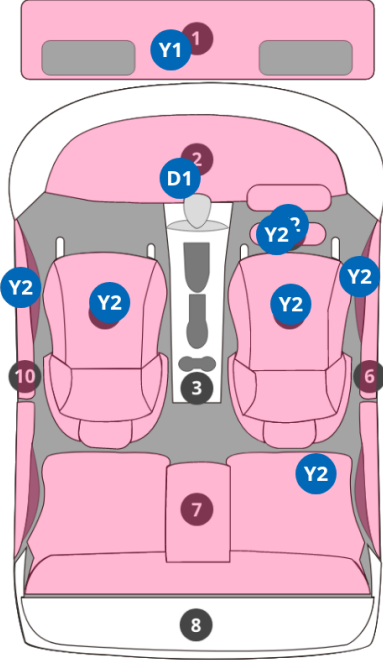
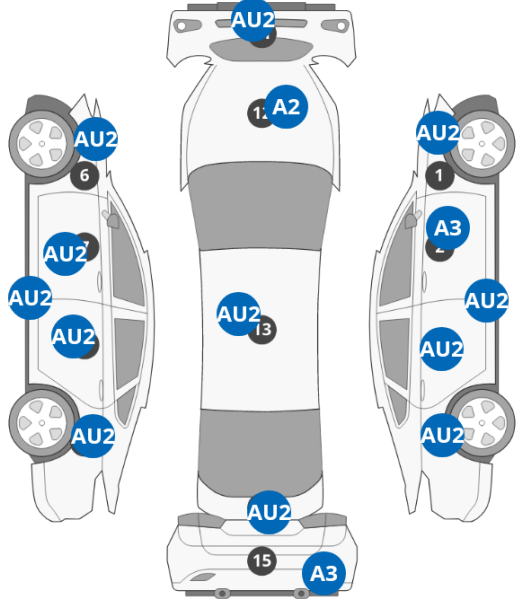
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.3	120	116	110
2	Boot Lid	109.0	102	100	125
3	Roof	101.2	102	105	95/103
4	Left Front Fender	99.1	93	104	100
5	Left Front Door	97.3	97	101	94
6	Center Panel Left				
7	Left Rear Door	97.2	98	99	95
8	Left Back Panel	104.2	116	100	97
9	Right Front Fender	97.7	98	96	99
10	Right Front Door	105.3	108	108	100
11	Center Panel Right				
12	Right Rear Door	101.2	97	101	106
13	Right Back Panel	102.3	101	97	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Worked - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Minimal	Remarks (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Medium / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with manual & warranty booklet, with spare tire, with inc tools & jack, with reverse camera, no spare key, scratches on taillight.