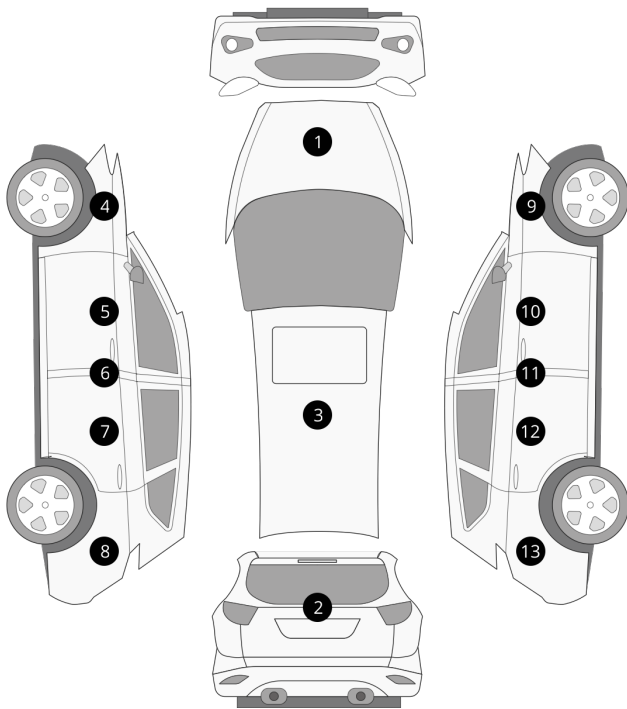


General Information

Date & Time: 06, Jan, 2026 08:22

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,392
Registration No.	DBR9552	Chassis No.	PA1B18F3XR4280350
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



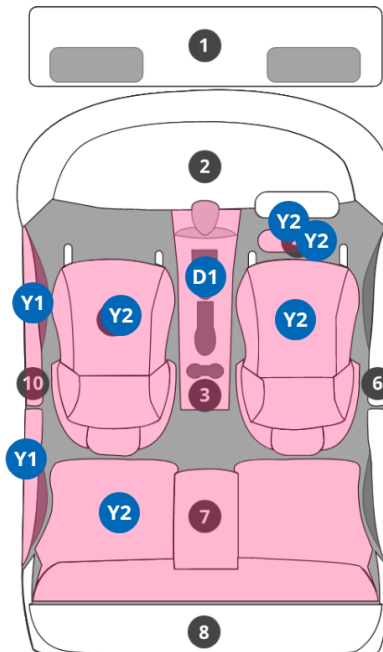
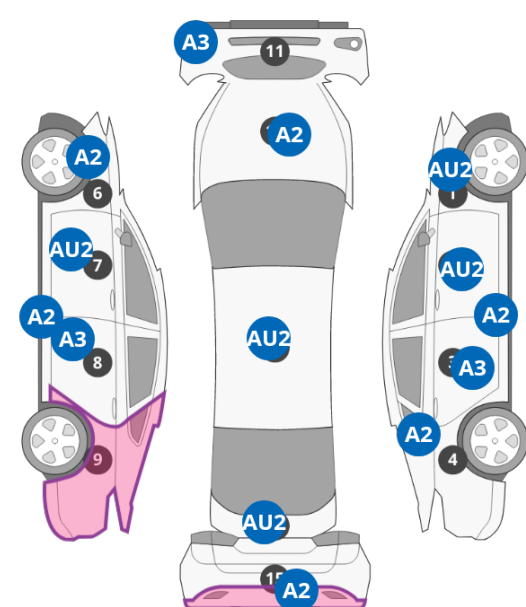
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.1	111	99	96
2	Boot Lid	101.4	103	96	105
3	Roof	100.6	98	111	88/106
4	Left Front Fender	95.4	95	95	96
5	Left Front Door	95.5	94	103	90
6	Center Panel Left				
7	Left Rear Door	97.7	104	101	88
8	Left Back Panel	210.6	371	127	134
9	Right Front Fender	111.7	107	99	129
10	Right Front Door	104.6	105	105	104
11	Center Panel Right				
12	Right Rear Door	109.3	109	108	111
13	Right Back Panel	103.0	96	100	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / Console, Switches, Vents - Worked - Minimal / (L) Front Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with inc tools & jack, with reverse camera, no warranty & manual booklet, no spare key, scratches on taillight.</p>