

## General Information

Date & Time: 05, Jan, 2026 14:53

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	89,133
<b>Registration No.</b>	NHJ1214	<b>Chassis No.</b>	PA1B18F34P4215135
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



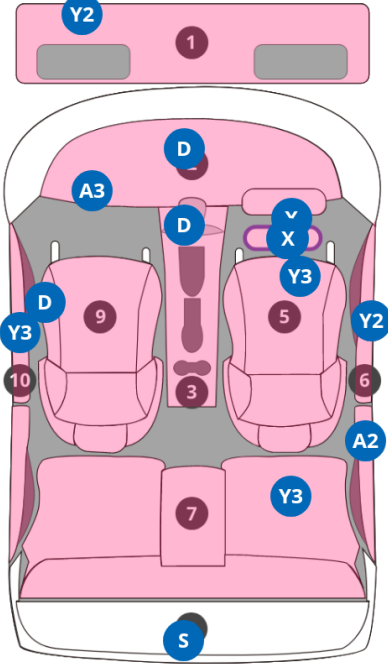
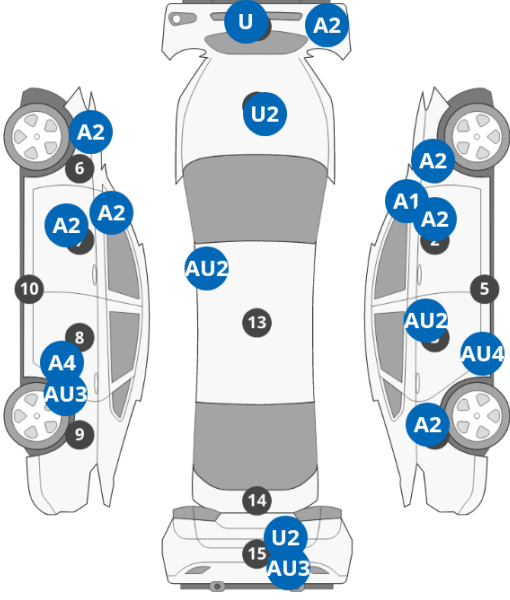
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	117	117	122
2	Boot Lid	117.6	104	107	142
3	Roof	101.6	109	111	91/96
4	Left Front Fender	98.7	99	100	98
5	Left Front Door	99.4	100	97	101
6	Center Panel Left				
7	Left Rear Door	102.5	108	101	99
8	Left Back Panel	101.7	106	97	102
9	Right Front Fender	97.7	97	97	99
10	Right Front Door	102.1	107	100	99
11	Center Panel Right				
12	Right Rear Door	101.5	99	100	106
13	Right Back Panel	112.6	109	111	118

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a :</b> Cut, Fray <b>d :</b> Loose, Deformed <b>k :</b> Animal Hair <b>s :</b> Smell <b>t :</b> Cigarette Burns <b>x :</b> Defective <b>y :</b> Stain</p>	 <p><b>A :</b> Scratch <b>AU :</b> Scratch &amp; Dent <b>B :</b> Modified <b>C :</b> Corrosion <b>G :</b> Stone chip <b>P :</b> Faded <b>S :</b> Rust <b>SC :</b> Rust &amp; Corrosion <b>U :</b> Dent <b>X :</b> Defective <b>Y :</b> Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / (R) Rear Trim - Cut, Crack - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / Overall Interior - Worn as per age - Yes / Steering Wheel - Worn, Peel, Crack - Medium / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Dent - Small / Roof - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light, possible flooding, park and plate light issue</p>