

General Information

Date & Time: 05, Jan, 2026 17:00

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	18,923
Registration No.	NHU5739	Chassis No.	PA1B18F30R4272211
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



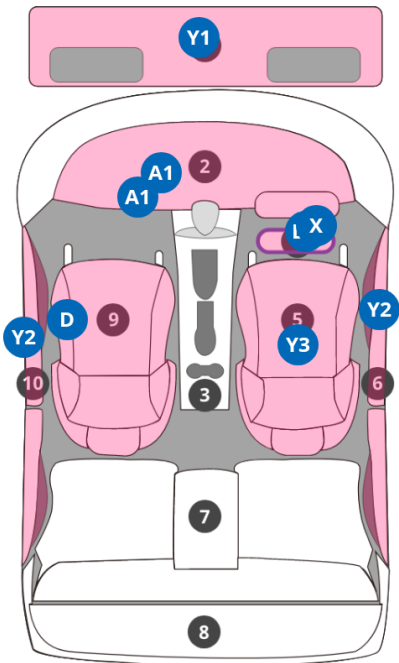
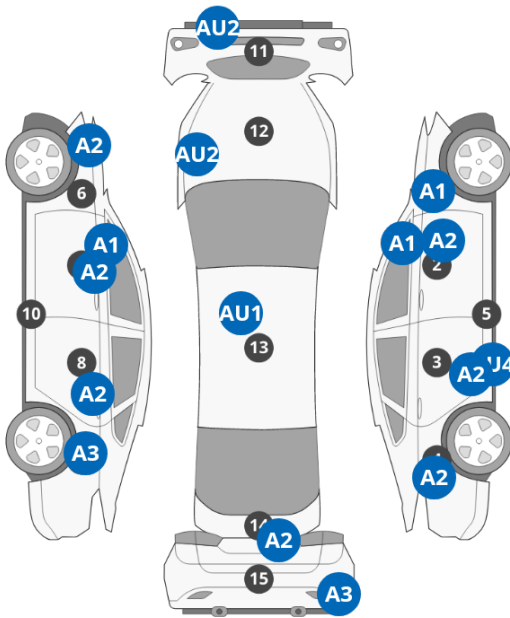
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	123	119	128
2	Boot Lid	110.6	102	107	123
3	Roof	104.1	107	105	98/107
4	Left Front Fender	98.7	99	100	97
5	Left Front Door	105.3	112	103	101
6	Center Panel Left				
7	Left Rear Door	113.0	119	117	103
8	Left Back Panel	108.0	112	106	106
9	Right Front Fender	109.6	108	111	110
10	Right Front Door	107.6	110	106	107
11	Center Panel Right				
12	Right Rear Door	111.0	105	118	110
13	Right Back Panel	110.0	104	113	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Mat Other - Missing - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Instrument Panel - Worn, Scratch, Cut, Crack - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Roof - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet and jack, no tools, with spare tire, with LTO plate, scratches on tail light, replaced head unit</p>