

General Information

Date & Time: 06, Jan, 2026 09:31

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	80,086
Registration No.	NIG9198	Chassis No.	PA1B18F36N4200021
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



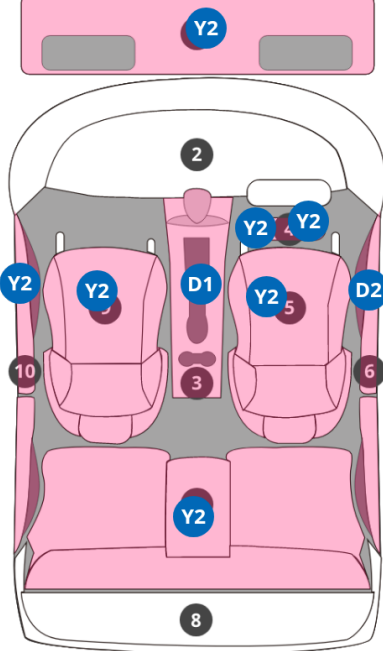
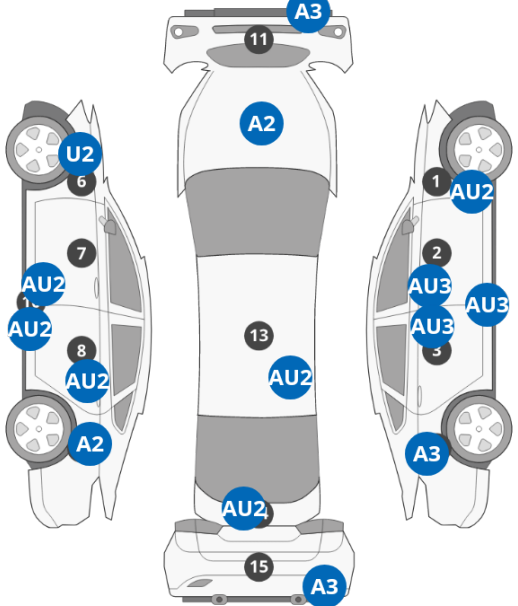
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.4	127	92	97
2	Boot Lid	105.6	107	106	104
3	Roof	148.3	305	99	89/100
4	Left Front Fender	98.3	95	100	100
5	Left Front Door	109.6	113	110	106
6	Center Panel Left				
7	Left Rear Door	106.6	111	104	105
8	Left Back Panel	106.8	119	103	99
9	Right Front Fender	106.6	98	101	121
10	Right Front Door	109.0	118	105	104
11	Center Panel Right				
12	Right Rear Door	115.6	102	133	112
13	Right Back Panel	97.6	93	96	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Worked - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks Roof - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

Inspector Notes

with LTO plate, with jack, no tools, no spare tire, no spare key, no warranty & manual booklet, issue on taillight, no reverse camera, issue o door handle passenger side, missing trunk cover.