

General Information

Date & Time: 06, Jan, 2026 12:40

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	21,648
Registration No.	DBR6009	Chassis No.	PA1B18F39R4278461
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



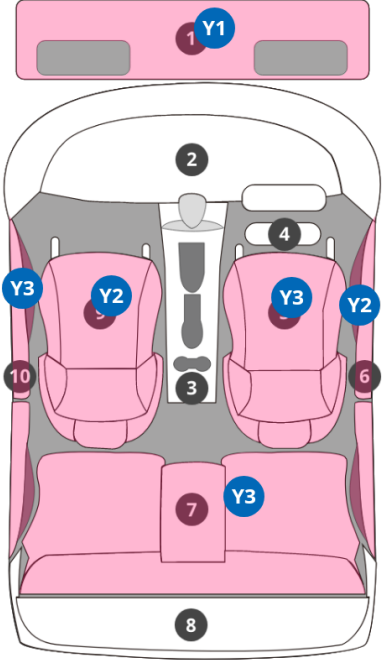
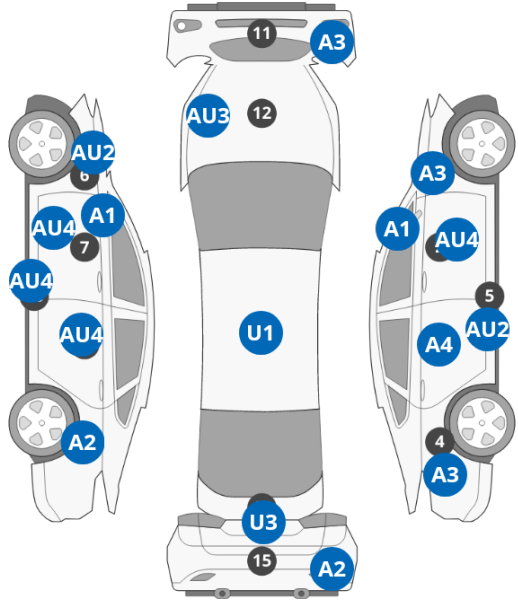
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.0	141	116	127
2	Boot Lid	108.0	101	114	109
3	Roof	95.3	96	96	93/97
4	Left Front Fender	104.6	111	103	100
5	Left Front Door	102.4	106	97	104
6	Center Panel Left				
7	Left Rear Door	101.3	107	104	93
8	Left Back Panel	110.3	118	108	105
9	Right Front Fender	112.3	115	112	110
10	Right Front Door	104.1	112	100	101
11	Center Panel Right				
12	Right Rear Door	106.9	100	98	123
13	Right Back Panel	107.3	100	112	110

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / Roof - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Medium</p>
Frame Evaluation : D	Functional Evaluation : C
<p>Remarks Left Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with reverse camera/No jack and tools/No warranty booklet/No spare key/No fog light / with check engine/ left side front and back door issue</p>