

## General Information

Date & Time: 06, Jan, 2026 15:18

<b>Make</b>	Toyota	<b>Model</b>	Rush
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	22,553
<b>Registration No.</b>	GBA8831	<b>Chassis No.</b>	MHKE8FF3PPK058017
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	White		

## Body / Panel Condition



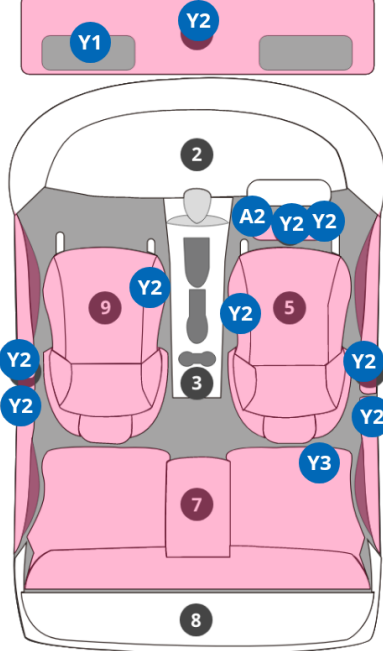
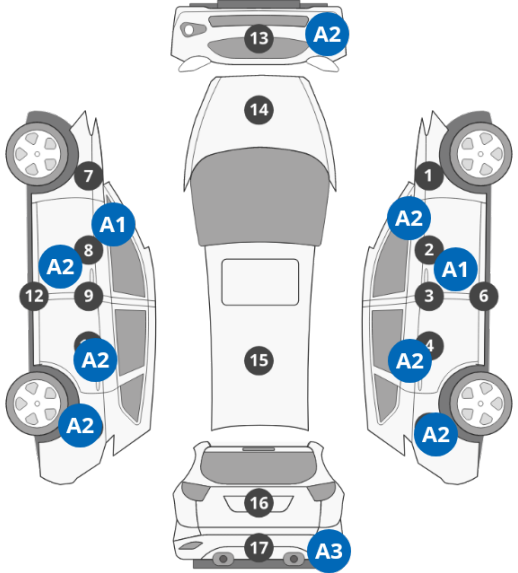
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.3	110	91	106
2	Boot Lid	87.6	88	89	86
3	Roof	91.6	88	87	96/97
4	Left Front Fender	96.6	98	92	100
5	Left Front Door	102.3	100	95	112
6	Center Panel Left				
7	Left Rear Door	101.3	107	94	103
8	Left Back Panel	96.0	107	95	86
9	Right Front Fender	99.3	102	99	97
10	Right Front Door	98.9	100	96	101
11	Center Panel Right				
12	Right Rear Door	100.5	101	92	109
13	Right Back Panel	95.1	91	92	102

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Cut, Crack - Small / Mat Other - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Minimal / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Rear Door, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Foul smell when aircondition is open. With warranty booklet jack and spare tire. Without tools and seat cover. 1 key. With LTO plate.</p>