

General Information

Date & Time: 29, Dec, 2025 11:36

Make	Toyota	Model	Vios
YOM	2017	Odo Meter Reading	90,357
Registration No.	NBB6035	Chassis No.	PA1B19F3XH4043278
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



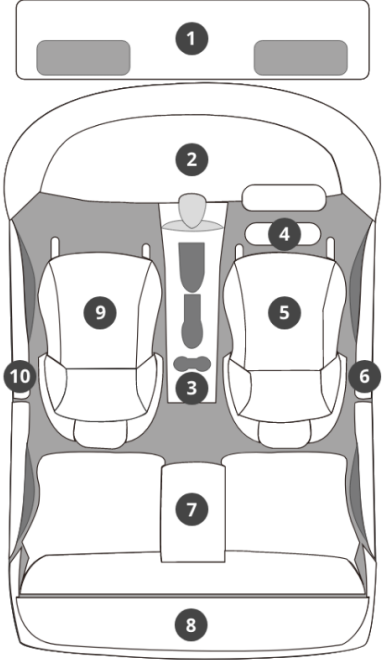
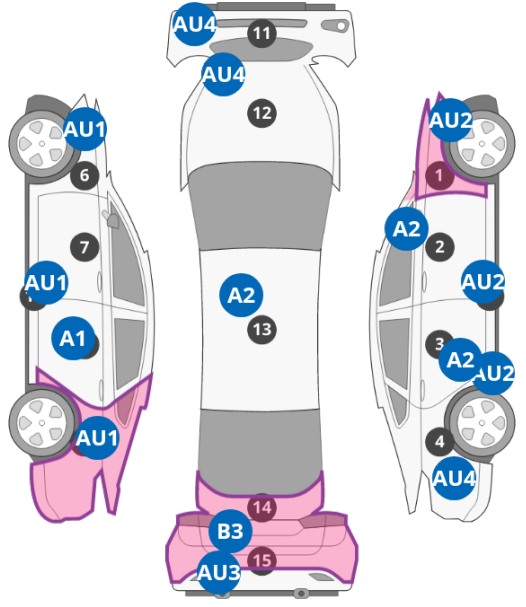
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	107	108	123
2	Boot Lid	114.6	123	113	108
3	Roof	99.7	96	100	99/104
4	Left Front Fender	107.1	99	105	118
5	Left Front Door	108.0	113	110	101
6	Center Panel Left				
7	Left Rear Door	138.3	135	138	142
8	Left Back Panel	148.0	151	145	148
9	Right Front Fender	276.6	474	188	168
10	Right Front Door	120.0	104	104	152
11	Center Panel Right				
12	Right Rear Door	115.6	116	109	122
13	Right Back Panel	118.3	124	105	126

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Modified - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with warranty booklet, with spare tire and jack, no tools, 1 key, scratches and cracks on headlight and taillight