

General Information

Date & Time: 29, Dec, 2025 11:35

Make	Toyota	Model	Corolla Altis
YOM	2008	Odo Meter Reading	271,032
Registration No.	ZTL216	Chassis No.	MR053ZEE108120756
CC	1.6	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



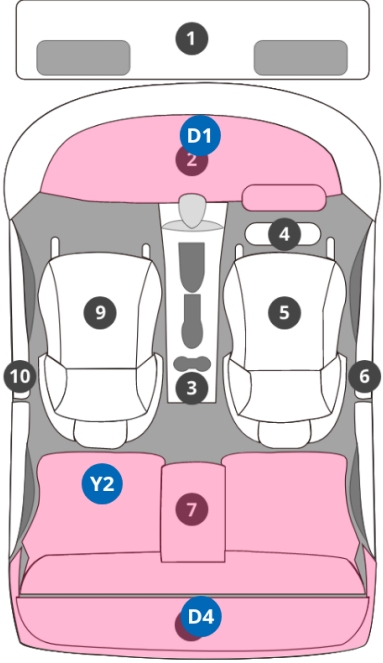
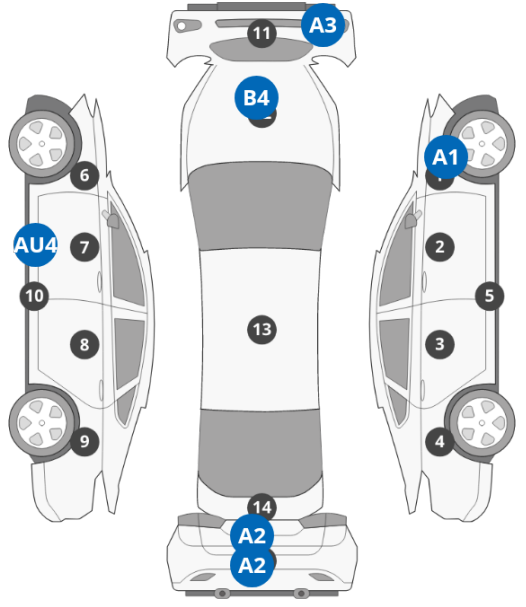
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	289.0	345	275	247
2	Boot Lid	395.6	337	218	632
3	Roof	196.2	205	186	203/191
4	Left Front Fender	160.3	165	162	154
5	Left Front Door	120.6	124	122	116
6	Center Panel Left				
7	Left Rear Door	122.0	123	124	119
8	Left Back Panel	401.6	491	313	401
9	Right Front Fender	292.3	356	276	245
10	Right Front Door	246.3	263	227	249
11	Center Panel Right				
12	Right Rear Door	333.6	365	285	351
13	Right Back Panel	425.3	297	282	697

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Glove Box - Loose, Deformed - Minimal / Trunk Room - Loose, Deformed - Large / Rear Seat - Grime - Small</p>	<p>Remarks Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Bonnet, Headlight - Modified - Large / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Audio, Radio - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare and jack, 1key, no warranty booklet and tools,scratches on headlight and taillight, no trunk cover,</p>