

General Information

Date & Time: 16, Jan, 2026 10:33

Make	Toyota	Model	Fortuner
YOM	2018	Odo Meter Reading	91,066
Registration No.	GAI8806	Chassis No.	MHFJB8GS0J1559262
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	White		

Body / Panel Condition



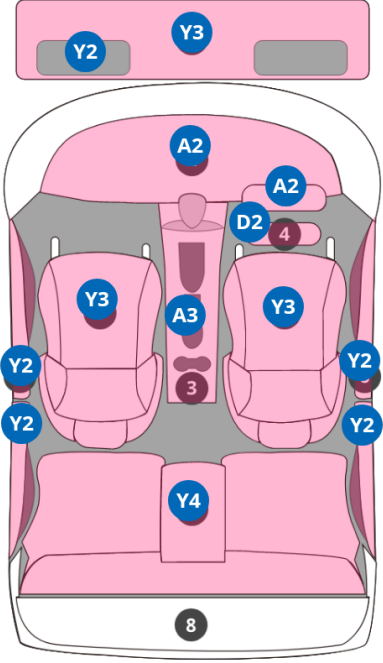
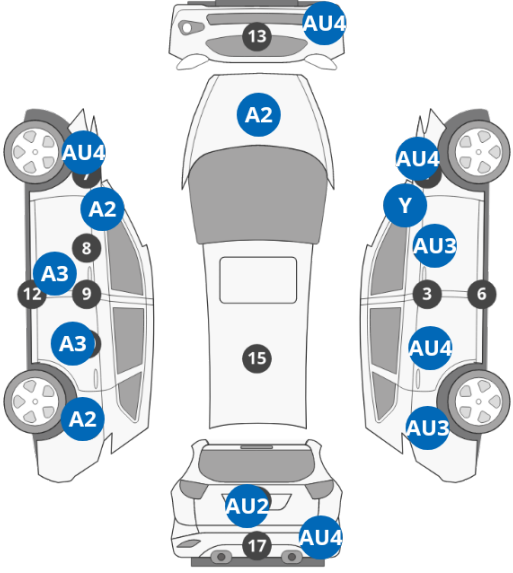
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	201.0	227	189	187
2	Boot Lid	130.9	99	196	98
3	Roof	111.9	119	129	107/93
4	Left Front Fender	105.6	101	112	104
5	Left Front Door	92.6	86	84	108
6	Center Panel Left				
7	Left Rear Door	103.7	85	129	98
8	Left Back Panel	119.6	120	113	126
9	Right Front Fender	108.0	111	112	101
10	Right Front Door	103.9	100	103	109
11	Center Panel Right				
12	Right Rear Door	113.0	128	100	111
13	Right Back Panel	122.6	143	103	122

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Large / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small</p>	<p>Remarks Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Crack - Cracks / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Parking sensor issue. Aircon blower issue, Original mattings missing. Headlight missing. Crack right tail light. Without warranty booklet, spare tire, and seat cover. With jack and tools. 1 key. With LTO plate.</p>