

General Information

Date & Time: 09, Jan, 2026 14:45

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	52,935
Registration No.	HAH1459	Chassis No.	PA1B18F36P4236794
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



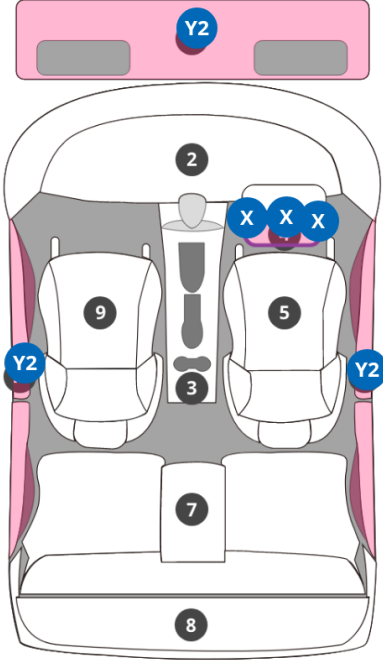
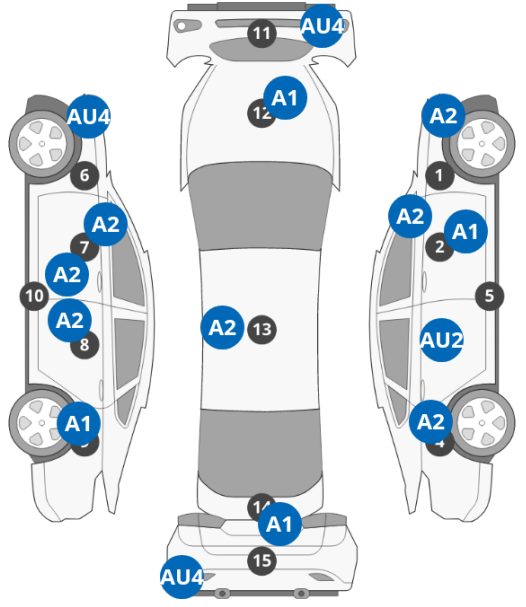
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	109	116	125
2	Boot Lid	125.0	119	127	129
3	Roof	100.0	105	109	96/90
4	Left Front Fender	102.6	107	98	103
5	Left Front Door	149.6	144	171	134
6	Center Panel Left				
7	Left Rear Door	146.0	146	148	144
8	Left Back Panel	155.3	154	141	171
9	Right Front Fender	108.0	109	106	109
10	Right Front Door	105.3	110	99	107
11	Center Panel Right				
12	Right Rear Door	159.3	147	166	165
13	Right Back Panel	111.3	104	112	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / Ceiling - Grime - Small / Mat Other - Missing - Yes / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Missing - Yes</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Rusted seat railings. Trunk cover/back seat cover missing. Aftermarket grille and missing front emblem. Putty cracks on front bumper. With warranty booklet, spare tire, jack and seat cover. Incomplete tools. 1 key. With LTO plate. With alarm system.</p>