

General Information

Date & Time: 29, Dec, 2025 11:37

Make	Toyota	Model	Veloz
YOM	2023	Odo Meter Reading	146,725
Registration No.	NEE9690	Chassis No.	MHFAB1BY9N3D45715
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Pearl White		

Body / Panel Condition



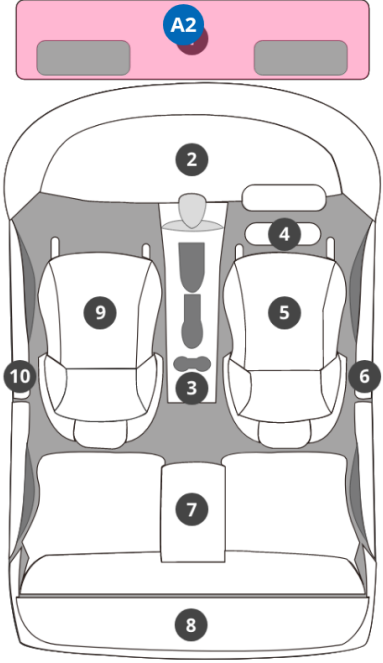
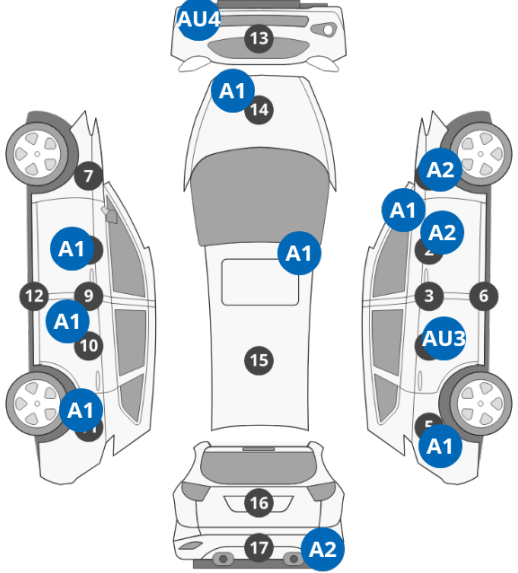
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	107	104	115
2	Boot Lid	109.3	115	118	95
3	Roof	110.2	117	111	111/102
4	Left Front Fender	114.0	112	117	113
5	Left Front Door	120.3	121	116	124
6	Center Panel Left				
7	Left Rear Door	120.6	120	113	129
8	Left Back Panel	121.3	133	122	109
9	Right Front Fender	105.0	105	108	102
10	Right Front Door	113.6	114	109	118
11	Center Panel Right				
12	Right Rear Door	119.6	126	116	117
13	Right Back Panel	135.0	141	125	139

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Cut, Crack - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools,scratches on headlight and taillight