

General Information

Date & Time: 06, Jan, 2026 09:42

Make	Mitsubishi	Model	Montero SPT
YOM	2023	Odo Meter Reading	118,090
Registration No.	CBD7867	Chassis No.	MMBGJKR10PH001950
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Black		

Body / Panel Condition



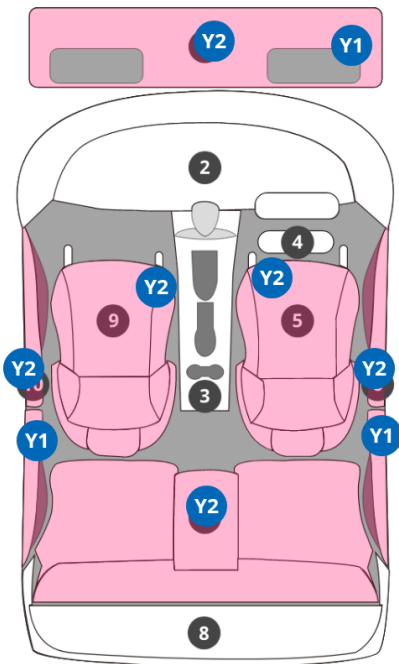
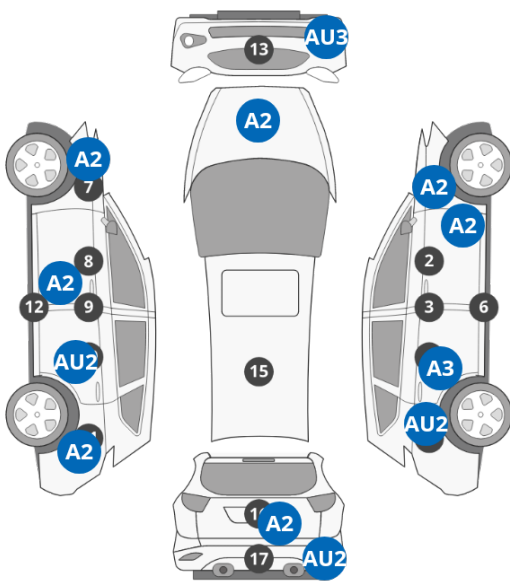
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	100	113	114
2	Boot Lid	97.0	95	100	96
3	Roof	90.9	81	89	95/99
4	Left Front Fender	108.6	114	107	105
5	Left Front Door	173.0	136	127	256
6	Center Panel Left				
7	Left Rear Door	298.6	147	626	123
8	Left Back Panel	95.6	98	95	94
9	Right Front Fender	107.6	113	108	102
10	Right Front Door	97.3	97	95	100
11	Center Panel Right				
12	Right Rear Door	97.7	91	99	103
13	Right Back Panel	92.9	99	91	89

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Grime - Minimal / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Non moving Towed unit. Cannot start engine due of electrical issues. Aircon vents issue. With warranty booklet, spare tire and jack. Incomplete tools. Without sear cover. 1 key. With LTO plate.</p>