

## General Information

Date & Time: 23, Dec, 2025 15:52

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	84,760
<b>Registration No.</b>	BAE8302	<b>Chassis No.</b>	MHKA4D5FMJ057275
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Orange		

## Body / Panel Condition



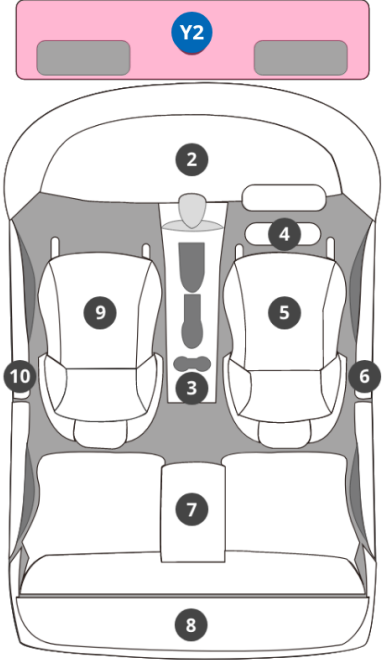
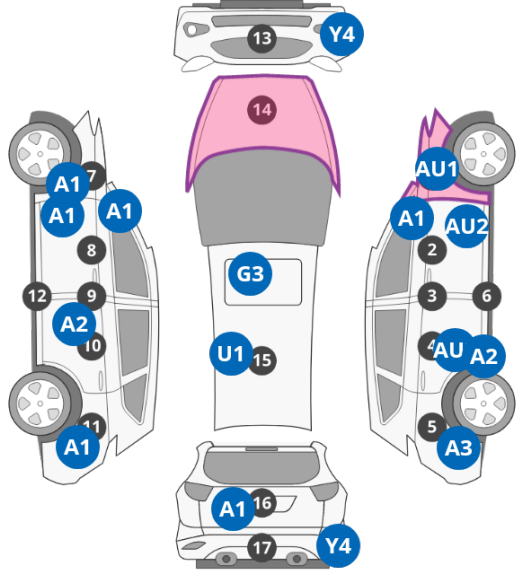
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	165.0	178	177	140
2	Boot Lid	103.2	94	111	105
3	Roof	79.5	80	80	80/79
4	Left Front Fender	100.1	91	104	106
5	Left Front Door	98.3	95	101	99
6	Center Panel Left				
7	Left Rear Door	101.0	105	99	99
8	Left Back Panel	94.3	100	96	87
9	Right Front Fender	184.3	137	146	270
10	Right Front Door	98.7	93	101	102
11	Center Panel Right				
12	Right Rear Door	98.3	104	98	93
13	Right Back Panel	99.2	105	93	100

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Ceiling - Grime - Small	<b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Front Windshield - Scratch, Stone chip - Medium / Bonnet, Headlight - Repair mark - Yes / Roof - Dent - Minimal
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
<b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	<b>Remarks</b> Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
with Lto plate, with jack, 1key, no tools, spare tire issue, scratches on taillights, headlights issue, aircon issue,