

## General Information

Date & Time: 05, Jan, 2026 10:27

<b>Make</b>	Kia	<b>Model</b>	Rio
<b>YOM</b>	2018	<b>Odo Meter Reading</b>	44,632
<b>Registration No.</b>	FAE1050	<b>Chassis No.</b>	KNADB514BJ6158109
<b>CC</b>	1.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Red		

## Body / Panel Condition



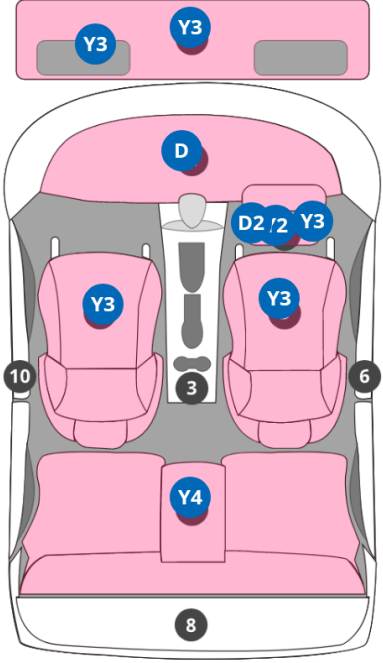
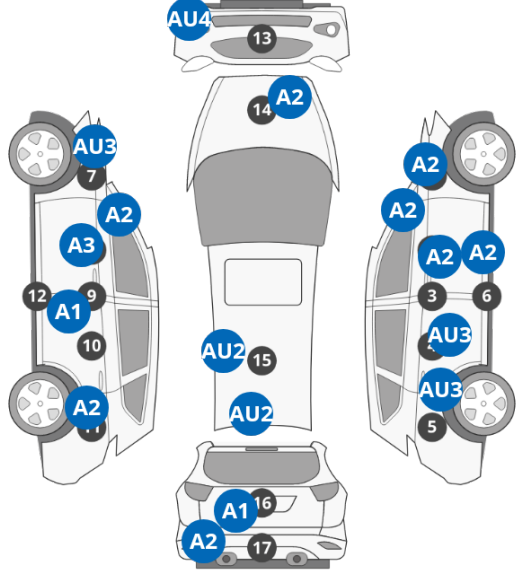
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	171.6	162	171	182
2	Boot Lid	162.0	147	163	176
3	Roof	112.5	114	104	119/113
4	Left Front Fender	149.6	145	148	156
5	Left Front Door	191.6	190	208	177
6	Center Panel Left				
7	Left Rear Door	189.6	166	184	219
8	Left Back Panel	168.3	205	156	144
9	Right Front Fender	130.0	119	145	126
10	Right Front Door	132.3	129	129	139
11	Center Panel Right				
12	Right Rear Door	147.6	142	160	141
13	Right Back Panel	176.3	150	147	232

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>  Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Large / Ceiling - Grime - Medium / Mat Other - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Sunvisor, Sunglass Holder - Grime - Medium</p>	<p><b>Remarks</b>  Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch &amp; Dent - Small / Roof Spoiler, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b>  Defects not found</p>	<p><b>Remarks</b>  Power Window (each) - Stuck, Gap - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Possible flooding. Power Window Master switch, Front right and rear right switch issue. Window lock issue. Front left signal light issue. Without warranty booklet, tools and seat cover. With spare tire and jack. 1 key. With LTO plate.</p>