

General Information

Date & Time: 12, Jan, 2026 18:58

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	37,845
Registration No.	NEV5651	Chassis No.	MHKAADF5FMJ056366
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



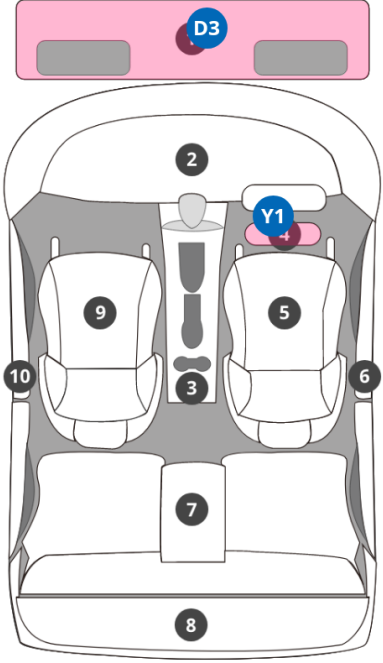
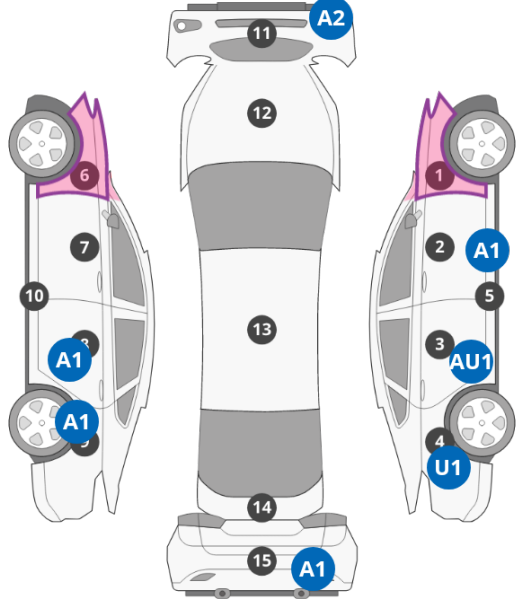
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.5	102	89	93
2	Boot Lid	99.9	92	106	102
3	Roof	78.3	74	78	79/83
4	Left Front Fender	166.6	161	164	175
5	Left Front Door	153.0	173	149	137
6	Center Panel Left				
7	Left Rear Door	98.4	101	100	94
8	Left Back Panel	99.0	99	99	99
9	Right Front Fender	99.3	100	92	106
10	Right Front Door	110.8	92	95	145
11	Center Panel Right				
12	Right Rear Door	95.8	97	99	92
13	Right Back Panel	93.2	95	91	94

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Loose, Deformed - Medium / (L) Front Floor Mat - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty, no tools, scratches headlight and taillight, check engine