

General Information

Date & Time: 05, Jan, 2026 12:44

Make	Toyota	Model	Vios
YOM	2018	Odo Meter Reading	37,825
Registration No.	FAD6493	Chassis No.	PA1B19F39J4060210
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



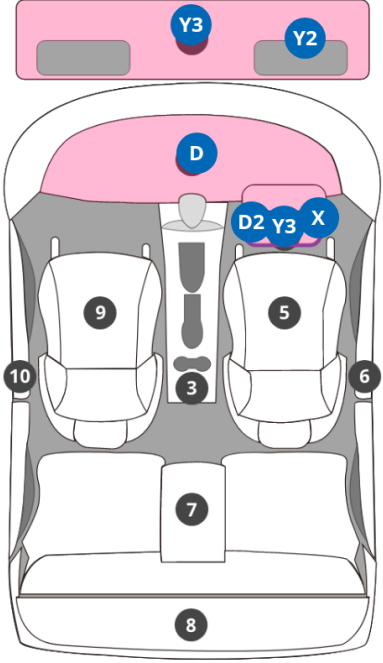
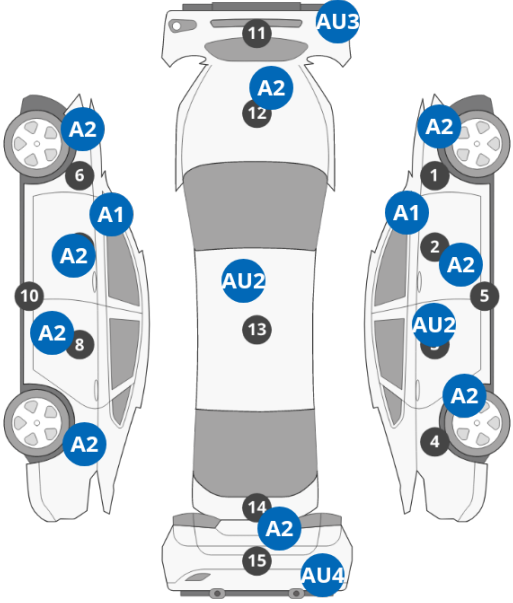
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	105	102	132
2	Boot Lid	110.3	109	110	112
3	Roof	118.0	127	108	115/122
4	Left Front Fender	113.3	116	115	109
5	Left Front Door	165.0	172	152	171
6	Center Panel Left				
7	Left Rear Door	192.3	194	187	196
8	Left Back Panel	178.6	195	164	177
9	Right Front Fender	150.3	139	154	158
10	Right Front Door	222.3	199	245	223
11	Center Panel Right				
12	Right Rear Door	162.6	162	158	168
13	Right Back Panel	168.6	170	162	174

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Buttons at steering wheel not working. With front bodykit and rear spoiler. Without warranty booklet, spare tire, and tools. With jack and seat cover. 1 key.</p>