

General Information

Date & Time: 29, Dec, 2025 18:48

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	27,606
Registration No.	NFR3787	Chassis No.	PA1B18F34R4249644
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



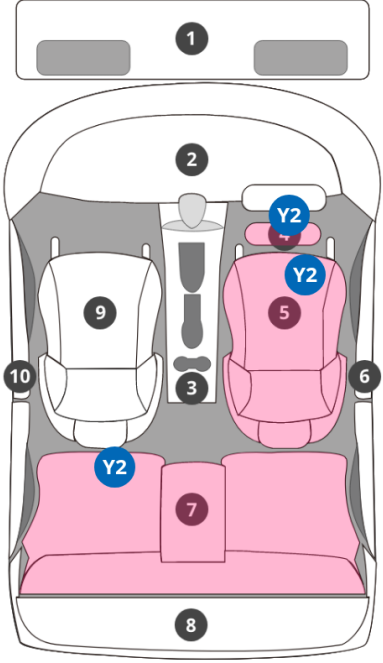
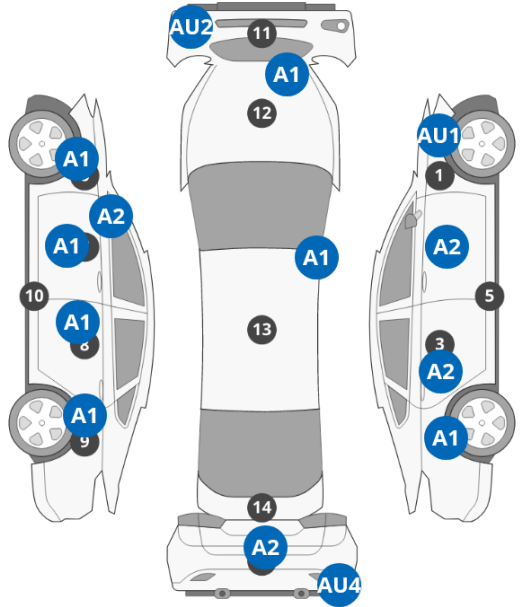
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.3	123	118	120
2	Boot Lid	111.0	113	103	117
3	Roof	113.5	127	108	110/109
4	Left Front Fender	124.0	160	105	107
5	Left Front Door	110.6	109	111	112
6	Center Panel Left				
7	Left Rear Door	111.0	117	109	107
8	Left Back Panel	117.6	120	116	117
9	Right Front Fender	108.6	112	112	102
10	Right Front Door	109.6	114	105	110
11	Center Panel Right				
12	Right Rear Door	116.0	111	112	125
13	Right Back Panel	122.0	121	119	126

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with jack and tools, 3keys, no spare tire, scratches on headlight, Cracked taillight</p>