

General Information

Date & Time: 29, Dec, 2025 18:52

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	6,319
Registration No.	CCF9416	Chassis No.	PA1B18F36P4274537
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



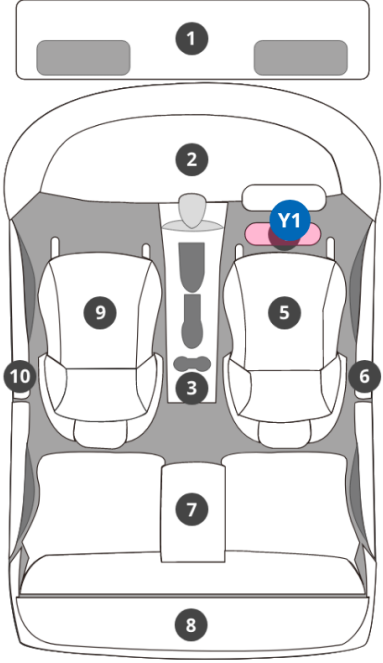
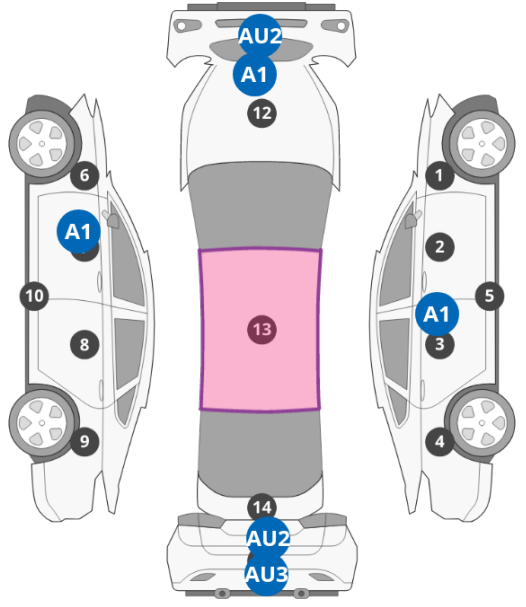
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	231.0	240	214	239
2	Boot Lid	165.6	167	158	172
3	Roof	155.7	150	149	177/147
4	Left Front Fender	139.3	137	140	141
5	Left Front Door	144.3	140	143	150
6	Center Panel Left				
7	Left Rear Door	161.6	166	167	152
8	Left Back Panel	100.4	102	97	102
9	Right Front Fender	119.3	125	111	122
10	Right Front Door	190.6	194	179	199
11	Center Panel Right				
12	Right Rear Door	148.0	142	137	165
13	Right Back Panel	150.3	144	145	162

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Repair mark - Yes / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with warranty booklet, with spare tire and jack, 3keys, no tools, scratches on headlights and taillight