

General Information

Date & Time: 05, Jan, 2026 13:37

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	17,007
Registration No.	CCG3954	Chassis No.	PA1B18F33R4264829
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



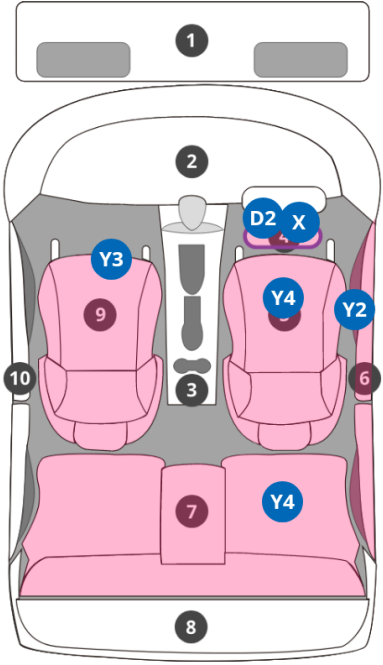
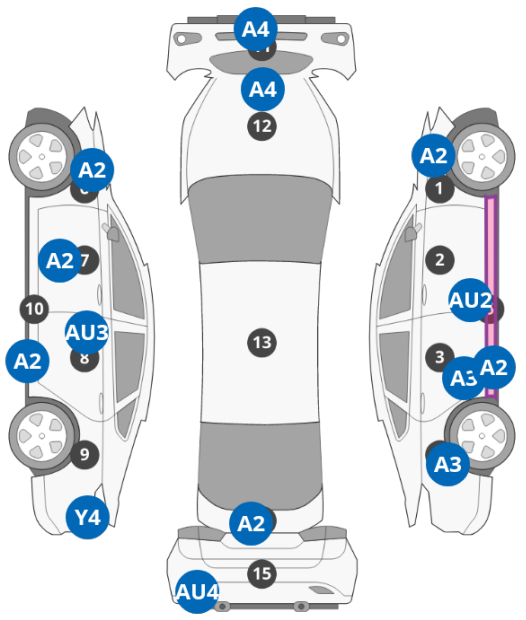
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.5	103	104	89
2	Boot Lid	94.3	92	95	96
3	Roof	100.0	94	92	114/100
4	Left Front Fender	91.8	92	84	100
5	Left Front Door	94.7	101	89	94
6	Center Panel Left				
7	Left Rear Door	94.6	92	94	98
8	Left Back Panel	96.1	102	96	91
9	Right Front Fender	92.2	89	90	98
10	Right Front Door	97.5	94	109	90
11	Center Panel Right				
12	Right Rear Door	94.8	93	100	92
13	Right Back Panel	93.9	93	89	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / (R) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Medium</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Crack, Gap - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>no tools and spare tire/ with jack/ with LTO plate and warranty booklet/</p>