

General Information

Date & Time: 05, Jan, 2026 15:48

Make	Toyota	Model	Veloz
YOM	2024	Odo Meter Reading	36,383
Registration No.	CCC4868	Chassis No.	MHFAB1BY5P3077354
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



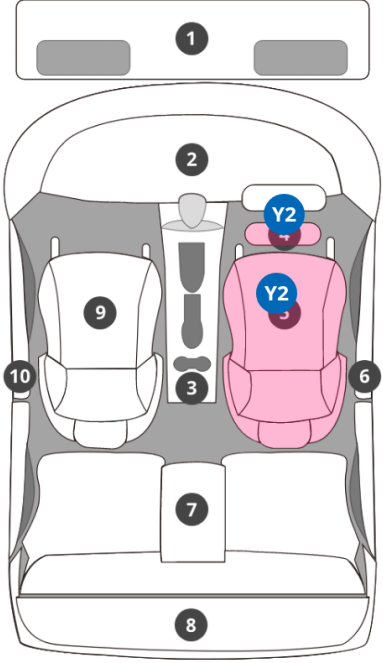
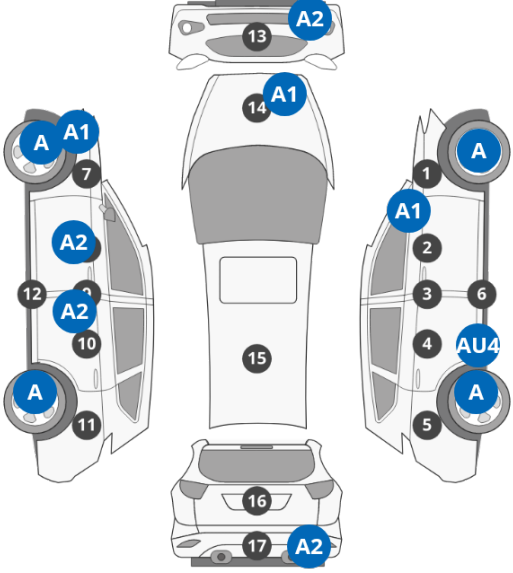
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.2	97	98	103
2	Boot Lid	97.5	98	103	92
3	Roof	112.1	127	125	98/98
4	Left Front Fender	96.6	100	98	92
5	Left Front Door	117.6	103	118	132
6	Center Panel Left				
7	Left Rear Door	115.0	117	104	124
8	Left Back Panel	112.6	130	103	105
9	Right Front Fender	94.7	97	98	90
10	Right Front Door	111.9	124	112	100
11	Center Panel Right				
12	Right Rear Door	113.0	110	108	121
13	Right Back Panel	120.3	121	110	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small</p>	<p>Remarks (R) Step - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Tyre - Crack, Cut - Yes / (R) Rear Tyre - Crack, Cut - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Tyre - Crack, Cut - Yes / (L) Front Tyre - Crack, Cut - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire, 2keys, no jack and tools, scratches on headlight and taillight</p>