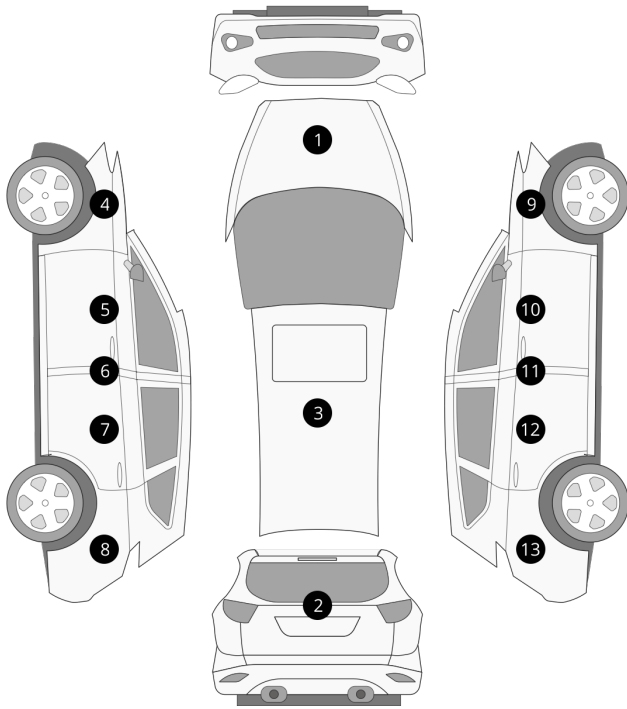


General Information

Date & Time: 05, Jan, 2026 17:11

Make	Toyota	Model	Hiace
YOM	2025	Odo Meter Reading	28,844
Registration No.	DBS7434	Chassis No.	JTFJ02P1R5039161
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



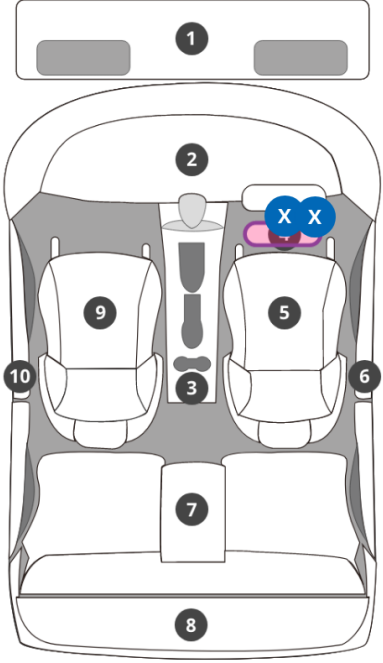
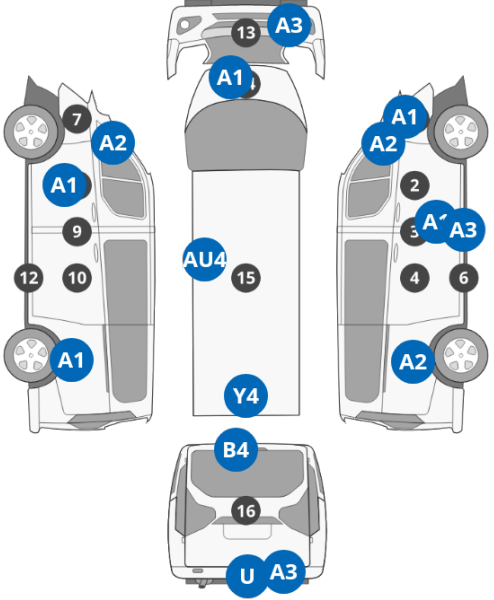
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	77.8	76	84	73
2	Boot Lid	68.5	72	73	61
3	Roof	78.5	71	82	76/86
4	Left Front Fender	79.9	80	83	77
5	Left Front Door	64.3	67	60	66
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	66.7	67	64	69
9	Right Front Fender	84.1	77	90	85
10	Right Front Door	65.7	65	67	65
11	Center Panel Right	67.3	60	65	77
12	Right Rear Door	69.2	71	69	67
13	Right Back Panel	72.5	76	72	70

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Center Panel - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Windshield - Damaged - Large / Trunk Hood, Rear Gate - Modified - Large / Muffler and Undercarriage Parts - Dent, Bent - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire and 3, 1key, no tools,scratches on headlight and taillight, no rear windshield,</p>