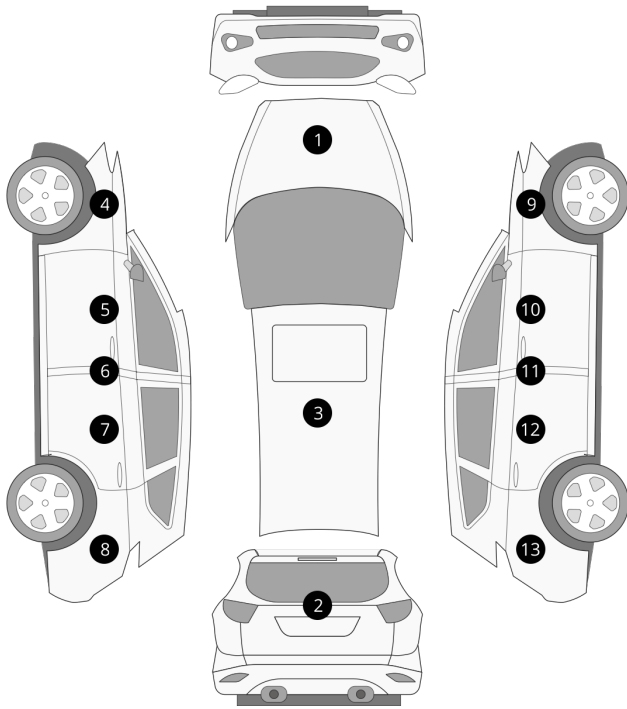


General Information

Date & Time: 07, Jan, 2026 16:09

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	31,445
Registration No.	NEY7078	Chassis No.	PA2JA82MR0145455
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Blackish Red Mica		

Body / Panel Condition



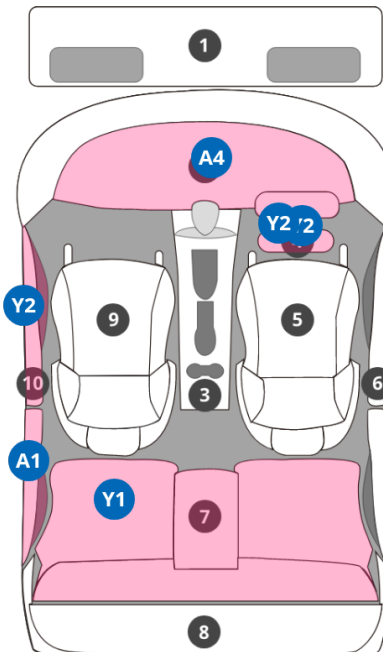
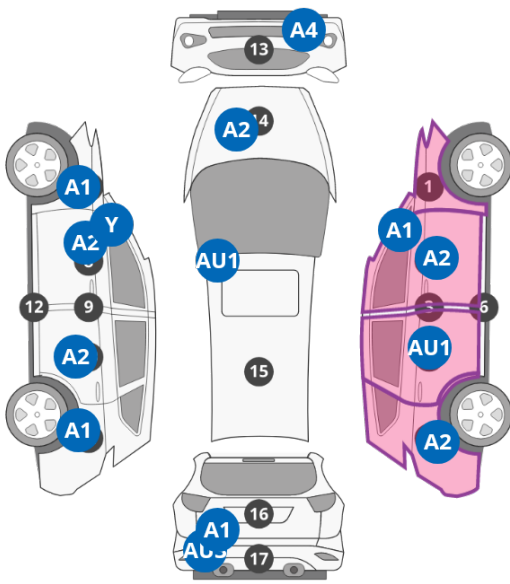
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	115	122	112
2	Boot Lid	108.3	110	110	105
3	Roof	94.5	94	88	100/97
4	Left Front Fender	103.6	105	106	100
5	Left Front Door	108.0	102	111	111
6	Center Panel Left				
7	Left Rear Door	106.6	115	103	102
8	Left Back Panel	111.0	108	116	109
9	Right Front Fender	166.6	158	160	182
10	Right Front Door	97.1	97	101	93
11	Center Panel Right				
12	Right Rear Door	101.0	101	104	98
13	Right Back Panel	106.6	110	105	105

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : A
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Steering Wheel - Worn, Peel, Crack - Large / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / (L) Rear Trim - Cut, Crack - Minimal / Mat Other - Grime - Small / Rear Seat - Grime - Minimal</p>	<p>Remarks Defects not found</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>1key, No Lto plate,no warranty booklet, no spare tire, no jack and tools,scratches on headlights and taillights</p>