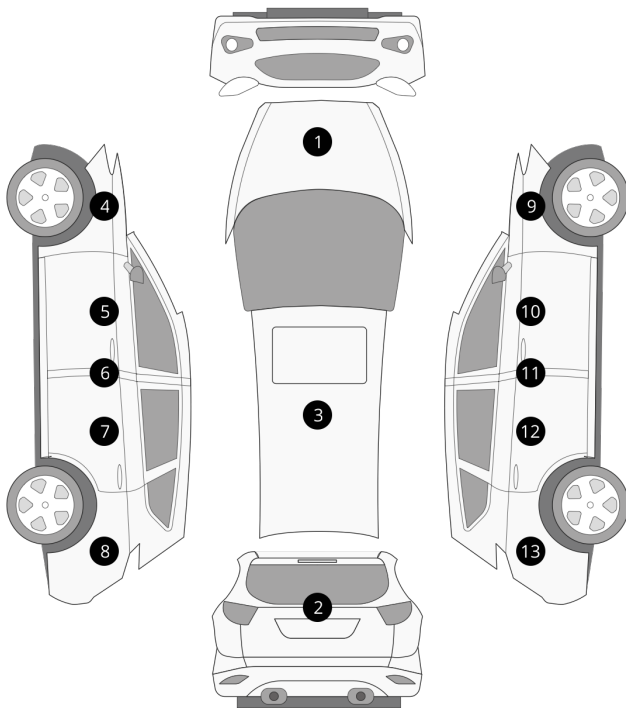


General Information

Date & Time: 07, Jan, 2026 11:32

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	3,771
Registration No.	CDA2659	Chassis No.	PA1B18F33S4291907
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



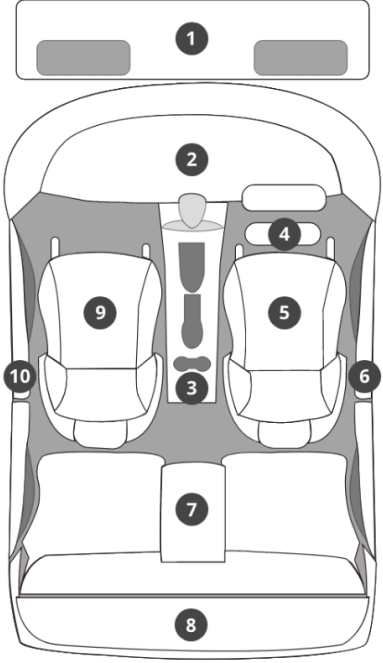
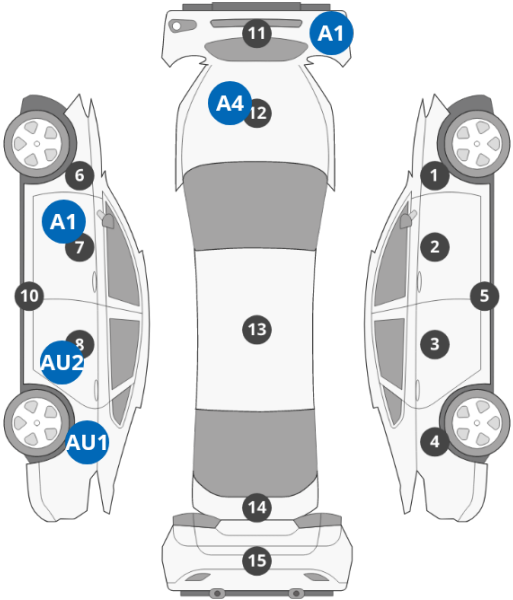
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	116	106	115
2	Boot Lid	116.3	116	115	118
3	Roof	96.9	101	100	94/93
4	Left Front Fender	96.4	96	96	98
5	Left Front Door	100.3	96	103	102
6	Center Panel Left				
7	Left Rear Door	105.0	110	97	108
8	Left Back Panel	110.6	120	109	103
9	Right Front Fender	104.6	105	102	107
10	Right Front Door	98.2	100	95	100
11	Center Panel Right				
12	Right Rear Door	104.6	104	103	107
13	Right Back Panel	104.3	99	107	107

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with tools, 1key, no warranty booklet, no spare tire and jack, issue on radio,