

General Information

Date & Time: 05, Jan, 2026 17:41

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	19,923
Registration No.	CCJ3907	Chassis No.	PA1B18F36R4274383
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



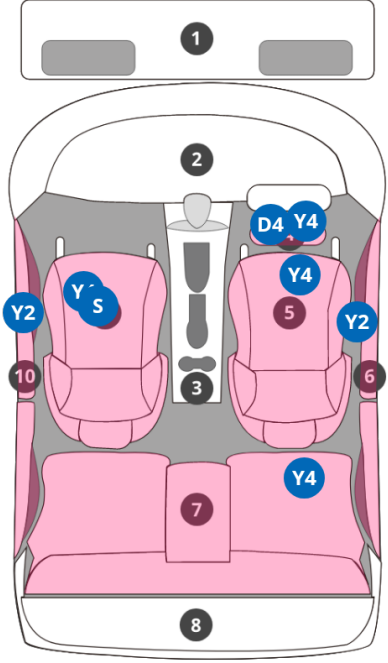
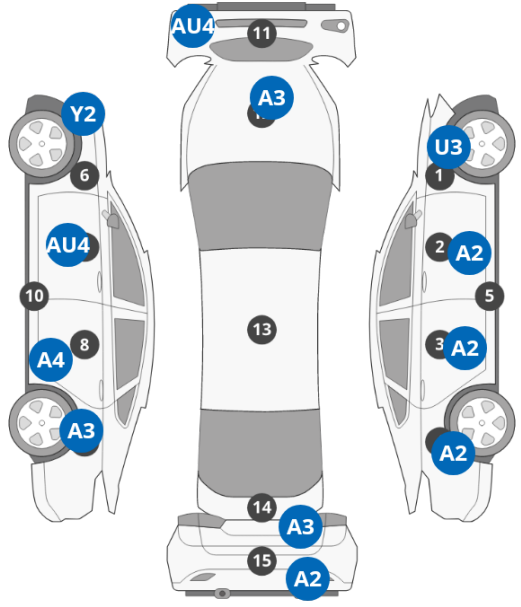
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	88.5	90	81	94
2	Boot Lid	88.3	81	90	94
3	Roof	77.4	81	80	69/80
4	Left Front Fender	76.4	73	79	78
5	Left Front Door	79.3	77	76	86
6	Center Panel Left				
7	Left Rear Door	81.2	89	81	75
8	Left Back Panel	89.3	92	92	85
9	Right Front Fender	75.7	76	74	78
10	Right Front Door	80.6	84	76	82
11	Center Panel Right				
12	Right Rear Door	83.2	79	80	91
13	Right Back Panel	91.8	91	89	96

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Large / Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Large / (L) Front Trim - Grime - Small / Overall Interior - Smell - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Crack, Gap - Small / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no LTO plate/ with warranty booklet and spare tire/ with jack and incomplete tools/</p>