

General Information

Date & Time: 21, Jan, 2025 17:15

Make	Honda	Model	Odyssey
YOM	2019	Mileage	110,134
Registration No.	DAL9126	Chassis No.	JHMRC1850KC201855
CC	2.4	Transmission	CVT
Fuel Type	Gas	Type of Body	Mini Van
Colour	Silver		

Body / Panel Condition



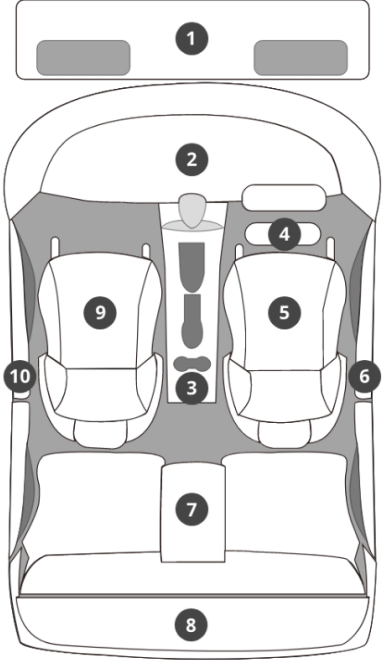
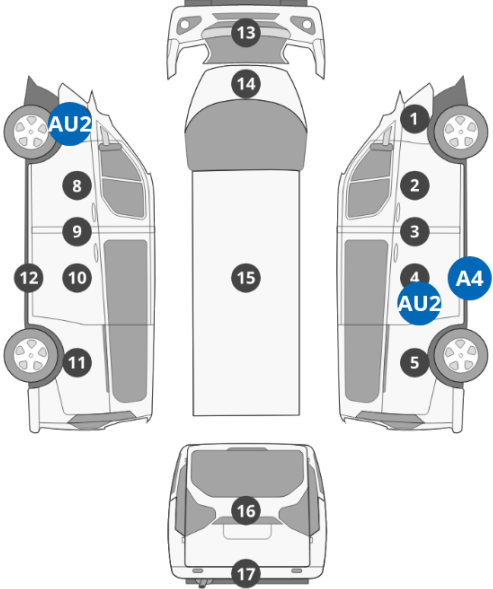
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	114	117	121
2	Boot Lid	138.3	161	130	124
3	Roof	111.2	126	110	106/103
4	Left Front Fender	101.3	100	106	98
5	Left Front Door	104.5	100	119	95
6	Center Panel Left				
7	Left Rear Door	93.7	98	97	86
8	Left Back Panel	96.5	97	96	97
9	Right Front Fender	101.3	100	106	98
10	Right Front Door	109.3	105	118	105
11	Center Panel Right				
12	Right Rear Door	100.1	93	108	99
13	Right Back Panel	96.3	92	99	97

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (L) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no spare tire/ no tire mobility kit/ with warranty booklet/ with tools/ with LTO plate/ no jack