

General Information

Date & Time: 16, Jan, 2026 14:53

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	58,060
Registration No.	GAV3998	Chassis No.	MHKA4DF5FMJ058226
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



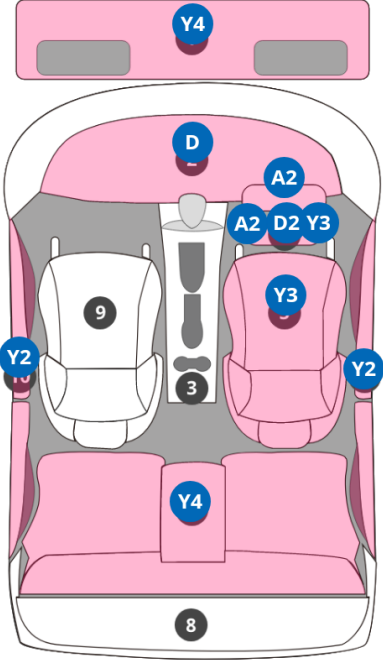
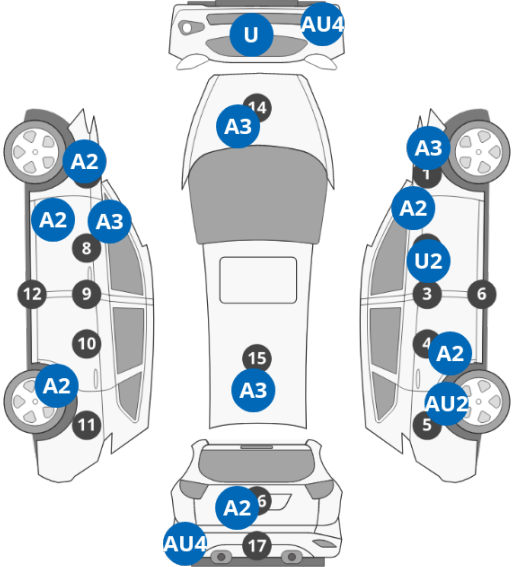
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.9	94	100	94
2	Boot Lid	94.7	87	100	98
3	Roof	86.7	73	93	92/89
4	Left Front Fender	90.5	90	94	88
5	Left Front Door	95.6	93	98	96
6	Center Panel Left				
7	Left Rear Door	121.0	123	120	120
8	Left Back Panel	161.0	156	162	165
9	Right Front Fender	146.6	153	167	120
10	Right Front Door	158.3	143	157	175
11	Center Panel Right				
12	Right Rear Door	155.6	150	159	158
13	Right Back Panel	163.3	171	151	168

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
	
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Large / Rear Seat - Grime - Large / Mat Other - Worked - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch - Medium / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

Inspector Notes
<p>Possible flooding. Crack right tail light. Trunk floor deformed. With warranty booklet, spare tire and jack. Without tools. Incomplete seat cover. 1 key. With LTO plate.</p>