

General Information

Date & Time: 05, Jan, 2026 11:40

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	17,556
Registration No.	HAH6399	Chassis No.	PENDING
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



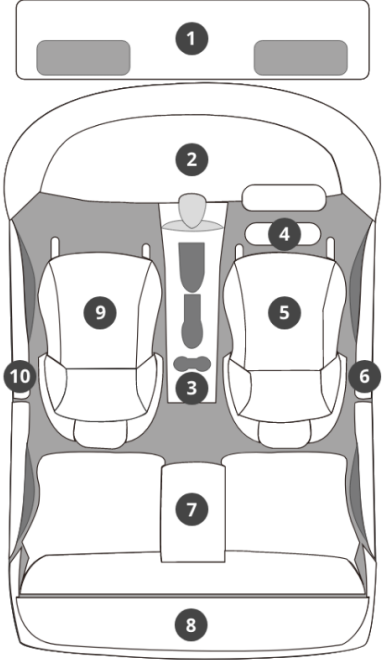
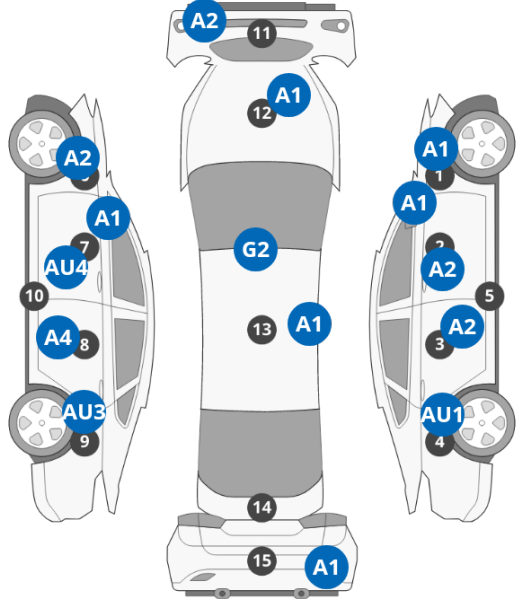
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	126	111	129
2	Boot Lid	104.4	104	99	110
3	Roof	98.9	100	100	103/93
4	Left Front Fender	110.3	108	115	108
5	Left Front Door	108.0	108	111	105
6	Center Panel Left				
7	Left Rear Door	107.0	119	101	101
8	Left Back Panel	108.3	111	107	107
9	Right Front Fender	107.6	111	110	102
10	Right Front Door	98.4	104	91	100
11	Center Panel Right				
12	Right Rear Door	105.1	103	99	114
13	Right Back Panel	105.1	105	99	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Windshield - Scratch, Stone chip - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with warranty booklet, with spare tire, with jack and tools, 3keys, scratches on headlight and taillight