

General Information

Date & Time: 12, Jan, 2026 18:46

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	29,662
Registration No.	NHS9246	Chassis No.	MR0JB8DD4R3554049
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



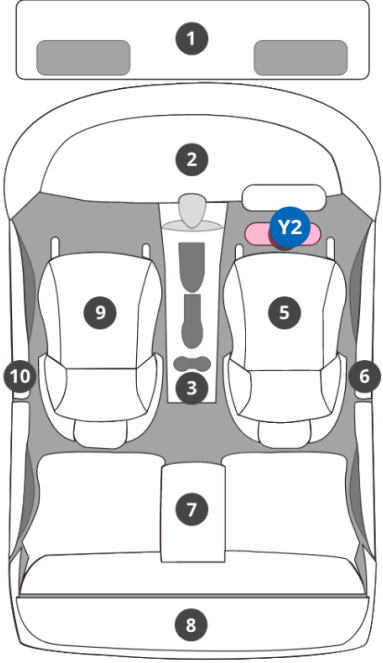
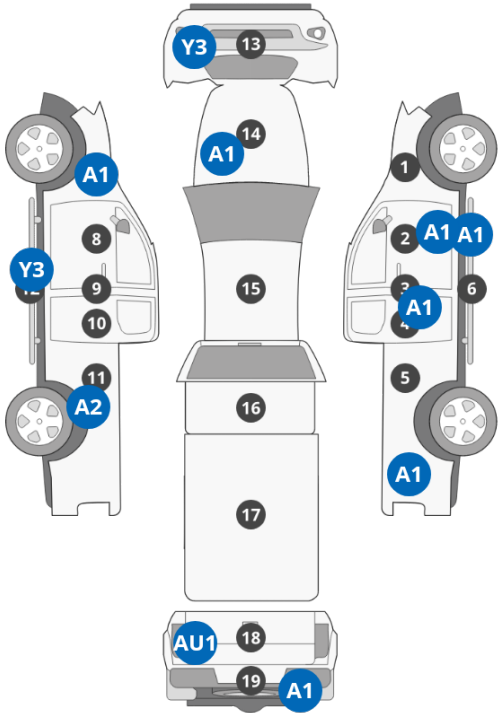
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	120	109	107
2	Boot Lid	92.0	89	87	101
3	Roof	101.9	98	86	103/121
4	Left Front Fender	93.3	89	99	92
5	Left Front Door	89.5	92	91	85
6	Center Panel Left				
7	Left Rear Door	89.7	88	92	90
8	Left Back Panel	98.7	97	96	103
9	Right Front Fender	98.5	96	100	100
10	Right Front Door	94.5	90	97	97
11	Center Panel Right				
12	Right Rear Door	89.7	77	91	101
13	Right Back Panel	104.6	100	105	109

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	B
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Floor Mat - Grime - Small</p>		<p>Remarks (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Rear Gate - Scratch & Dent - Minimal / (L) Side Gate - Scratch - Small / (L) Step, In-panel, Side Spoiler - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
With Lto plate, 1key, no warranty booklet, no spare tire, no jack and tools, scratches on headlights and taillights