

General Information

Date & Time: 07, Jan, 2026 16:07

Make	Mitsubishi	Model	Mirage
YOM	2017	Odo Meter Reading	54,478
Registration No.	NCA6241	Chassis No.	PAEA03TJHHA000557
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



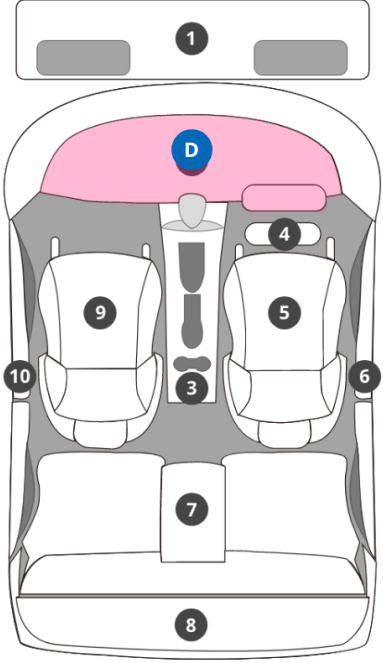
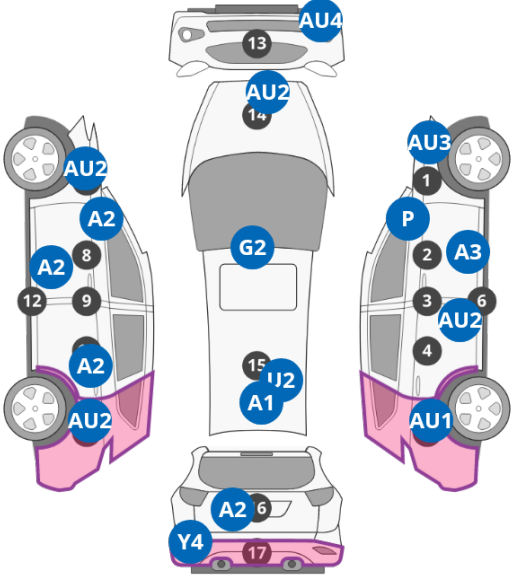
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	107	117	126
2	Boot Lid	105.0	109	102	104
3	Roof	97.3	100	86	108/95
4	Left Front Fender	107.0	106	101	114
5	Left Front Door	99.1	97	98	103
6	Center Panel Left				
7	Left Rear Door	104.6	111	100	103
8	Left Back Panel	109.6	108	113	108
9	Right Front Fender	106.6	110	100	110
10	Right Front Door	99.2	103	97	97
11	Center Panel Right				
12	Right Rear Door	107.3	101	104	117
13	Right Back Panel	99.6	74	104	121

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Windshield - Scratch, Stone chip - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Dent - Small / Roof Spoiler, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
With Lto plate, with warranty booklet, 2keys, with spare tire, no jack and tools, scratches on headlights and taillights