

General Information

Date & Time: 06, Jan, 2026 17:50

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	40,619
Registration No.	DBF8510	Chassis No.	PA1B18F31R4250069
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



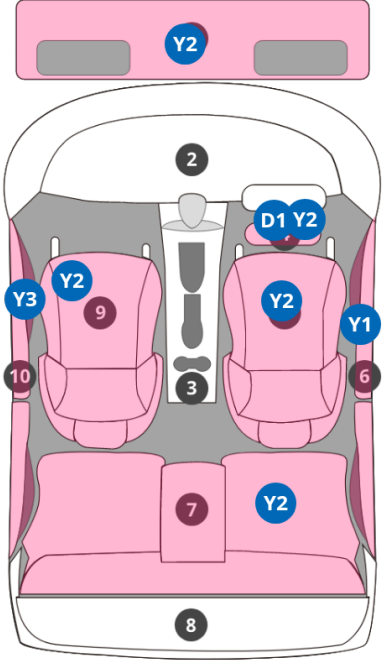
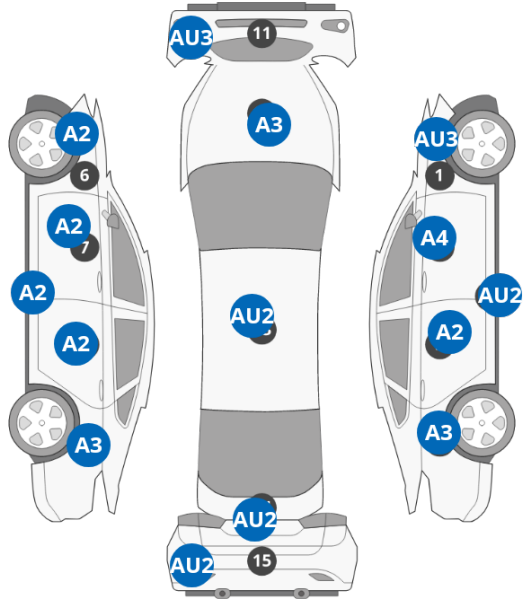
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	115	115	104
2	Boot Lid	108.0	107	103	114
3	Roof	104.1	100	99	92/125
4	Left Front Fender	99.3	103	101	94
5	Left Front Door	99.3	104	100	95
6	Center Panel Left				
7	Left Rear Door	102.6	107	101	100
8	Left Back Panel	111.0	116	120	97
9	Right Front Fender	107.6	114	106	103
10	Right Front Door	114.3	114	121	108
11	Center Panel Right				
12	Right Rear Door	112.6	108	113	117
13	Right Back Panel	111.3	111	110	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Medium / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Small / Carpet - Worked - Minimal / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with reverse camera, with manual booklet, with jack, no tools, no spare tire, no spare key, no warranty booklet, issue on cheek light right side, scratches on taillight.</p>