

General Information

Date & Time: 06, Jan, 2026 18:54

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	15,548
Registration No.	DBJ7692	Chassis No.	MHKAA1BC3PJ002303
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



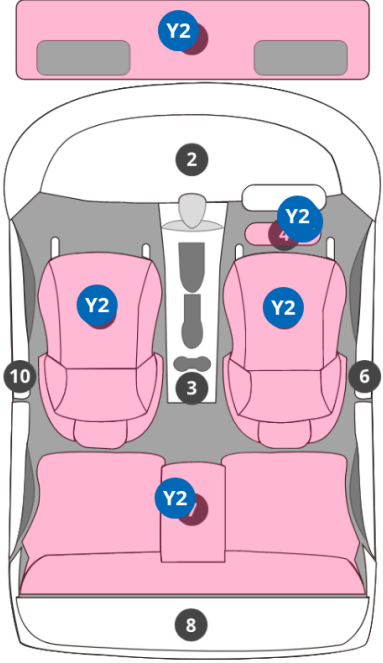
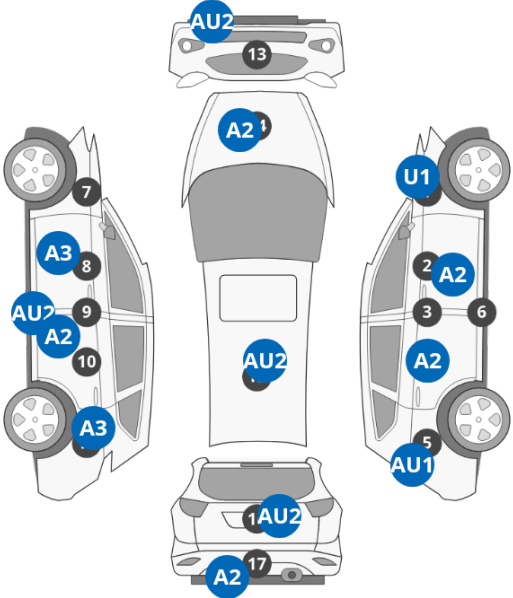
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	77.5	74	85	74
2	Boot Lid	76.9	78	73	80
3	Roof	96.4	106	102	113/65
4	Left Front Fender	79.7	78	86	76
5	Left Front Door	133.0	80	170	149
6	Center Panel Left				
7	Left Rear Door	113.7	99	90	153
8	Left Back Panel	85.3	89	83	85
9	Right Front Fender	77.6	61	86	86
10	Right Front Door	80.7	90	79	74
11	Center Panel Right				
12	Right Rear Door	90.1	91	88	92
13	Right Back Panel	69.7	64	65	81

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare key, with spare tire, with warranty booklet, with reverse camera, no tools & jack, no manual booklet, scratches on taillight, unusual sound at the bottom.</p>