

General Information

Date & Time: 06, Jan, 2026 18:27

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	23,123
Registration No.	DBM2725	Chassis No.	PA1B18F30R4243694
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



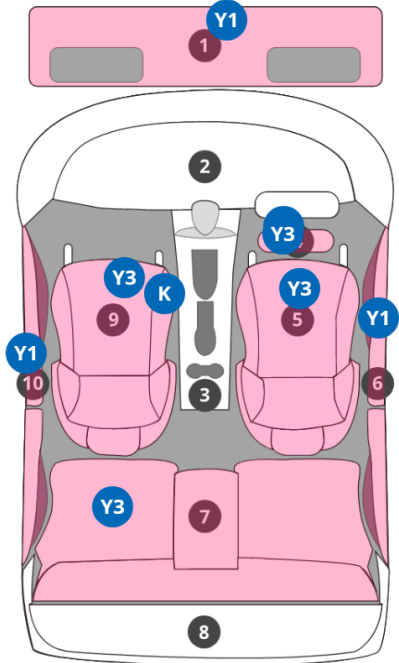
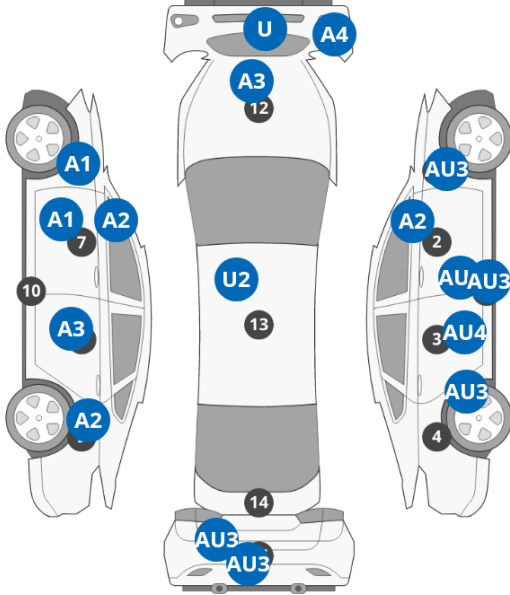
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	82.1	81	76	89
2	Boot Lid	104.0	104	102	106
3	Roof	97.6	95	100	90/106
4	Left Front Fender	116.3	114	126	109
5	Left Front Door	103.6	125	97	89
6	Center Panel Left				
7	Left Rear Door	98.7	98	92	106
8	Left Back Panel	105.0	111	105	99
9	Right Front Fender	130.3	132	133	126
10	Right Front Door	119.6	114	126	119
11	Center Panel Right				
12	Right Rear Door	99.0	101	98	99
13	Right Back Panel	99.2	96	94	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal</p>	<p>Remarks Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / Member (Bolted) - Dent - Yes / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Medium / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire and LTO PLATE, scratches on tail light</p>