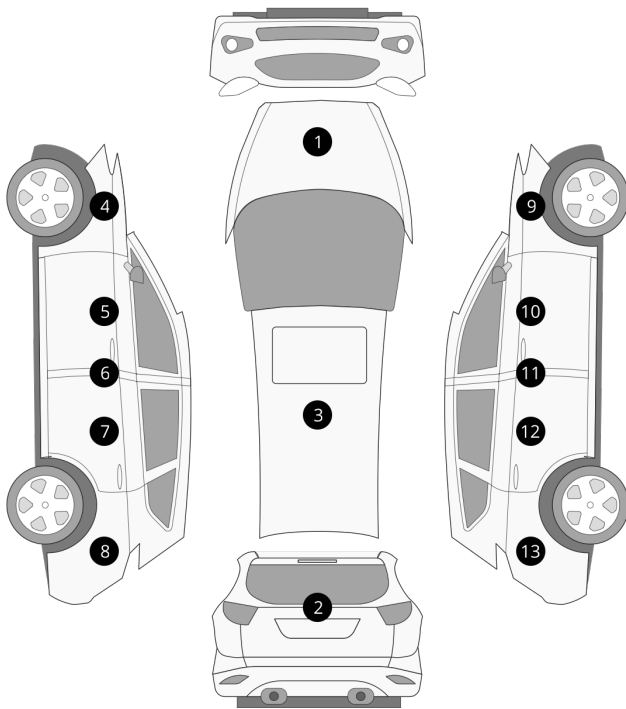


General Information

Date & Time: 07, Jan, 2026 13:53

Make	Toyota	Model	Avanza
YOM	2022	Odo Meter Reading	156,707
Registration No.	NFE3302	Chassis No.	MHFAA1BY5N0004213
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



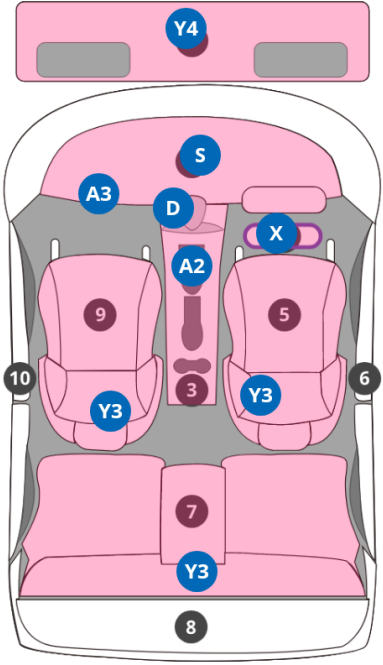
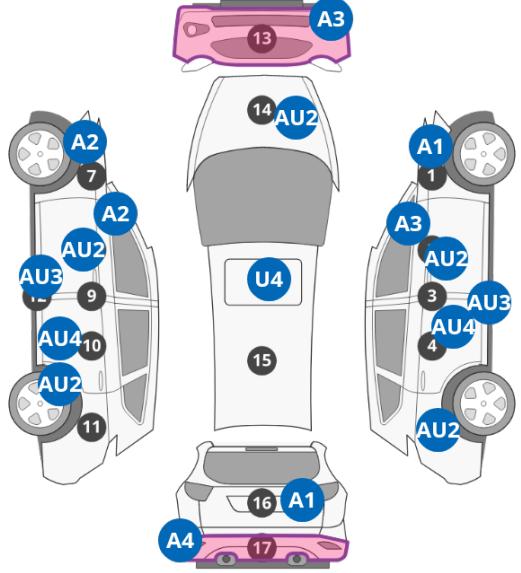
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	134.0	136	140	126
2	Boot Lid	164.0	156	171	165
3	Roof	117.0	129	127	103/109
4	Left Front Fender	114.5	102	97	145
5	Left Front Door	118.6	118	117	121
6	Center Panel Left				
7	Left Rear Door	128.6	142	117	127
8	Left Back Panel	113.0	115	103	121
9	Right Front Fender	191.3	178	171	225
10	Right Front Door	115.0	117	113	115
11	Center Panel Right				
12	Right Rear Door	117.3	119	116	117
13	Right Back Panel	112.6	123	100	115

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Knobs - Worn, Peel, Crack - Small / Steering Wheel - Worn, Peel, Crack - Medium / Ceiling - Grime - Large / Rear Seat - Grime - Medium / Mat Other - Missing - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large</p>
Frame Evaluation : B	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Air Conditioner - Function - Weak / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, jack, tools and spare tire, with LTO plate, scratches on headlight and tail light, possible flooding, fog lamp and plate light issue, abnormal noise and vibration on engine</p>