

General Information

Date & Time: 06, Jan, 2026 18:51

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	21,913
Registration No.	NJF1194	Chassis No.	MHFAA1BY0R0035374
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



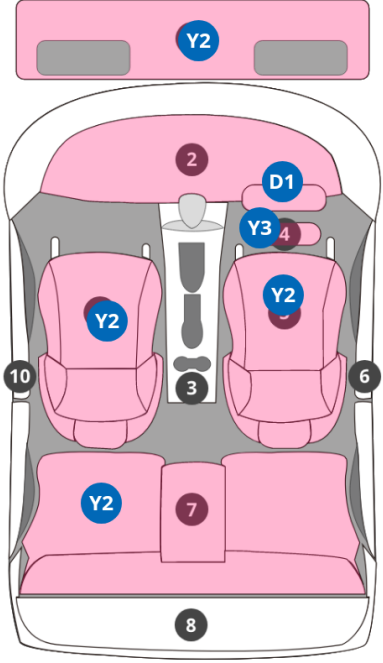
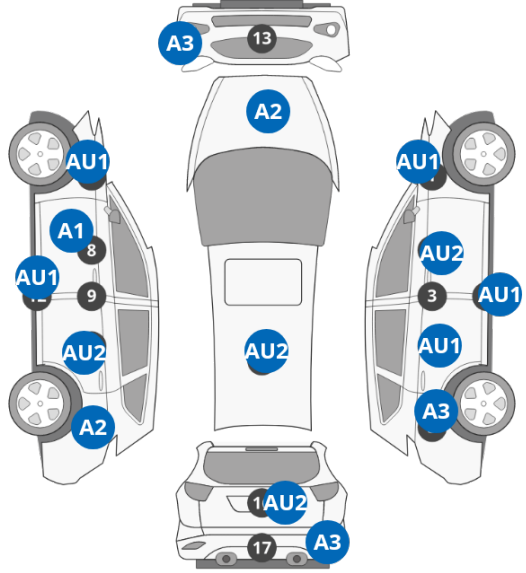
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.3	92	101	102
2	Boot Lid	106.6	108	103	109
3	Roof	144.0	218	127	128/103
4	Left Front Fender	119.0	112	133	112
5	Left Front Door	116.0	108	115	125
6	Center Panel Left				
7	Left Rear Door	122.0	119	106	141
8	Left Back Panel	132.0	133	121	142
9	Right Front Fender	110.6	116	113	103
10	Right Front Door	117.0	132	114	105
11	Center Panel Right				
12	Right Rear Door	113.6	112	109	120
13	Right Back Panel	124.0	126	114	132

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Worked - Minimal</p>		<p>Remarks Roof - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal</p>	
Frame Evaluation :	A	Functional Evaluation :	B
<p>Remarks Defects not found</p>		<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
with LTO plate, with inc tools & jack, with reverse camera, with spare tire, no warranty & manual booklet, no spare key, scratches on taillight.