

General Information

Date & Time: 07, Jan, 2026 09:43

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	16,613
Registration No.	DBM5752	Chassis No.	PA1B18F33R4244581
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



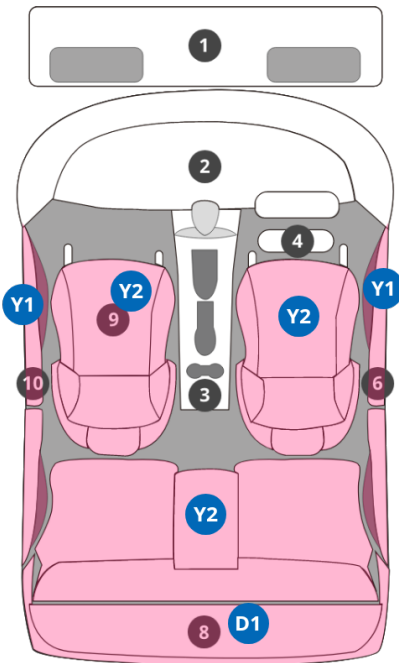
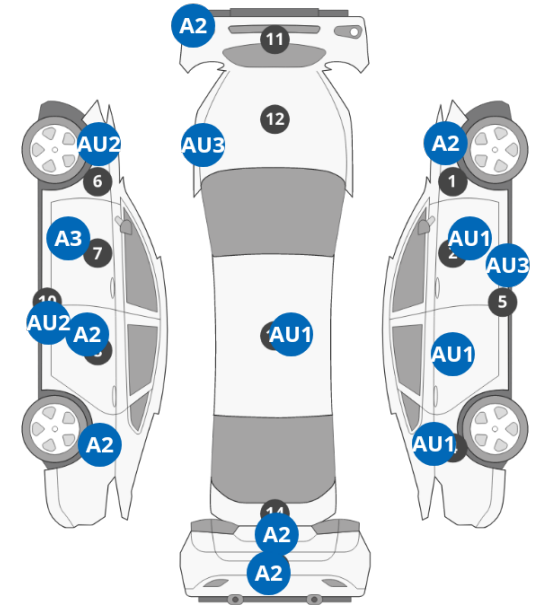
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.6	109	96	94
2	Boot Lid	105.6	104	100	113
3	Roof	95.9	96	99	87/102
4	Left Front Fender	97.7	101	92	100
5	Left Front Door	97.3	101	102	89
6	Center Panel Left				
7	Left Rear Door	97.8	102	95	97
8	Left Back Panel	104.3	110	104	99
9	Right Front Fender	104.6	115	101	98
10	Right Front Door	104.3	101	102	110
11	Center Panel Right				
12	Right Rear Door	103.1	96	101	112
13	Right Back Panel	102.5	97	100	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Trunk Room - Worked - Minimal</p>	<p>Remarks (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Roof - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty and manual booklet, with spare tire, with spare key, with incomplete tools & jack, with reverse camera, scratches on taillight.</p>