

General Information

Date & Time: 07, Jan, 2026 13:11

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	33,869
Registration No.	NGC9163	Chassis No.	PA1B18F31R4266580
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



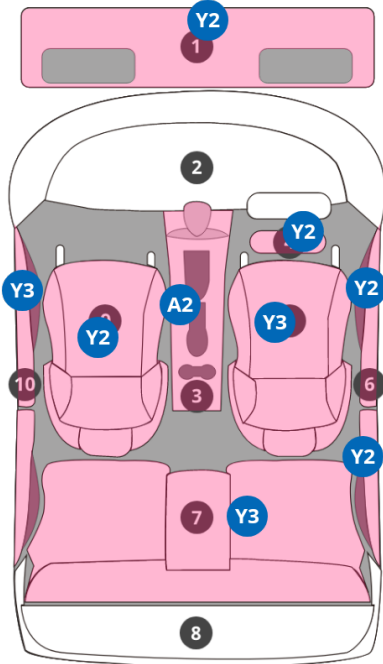
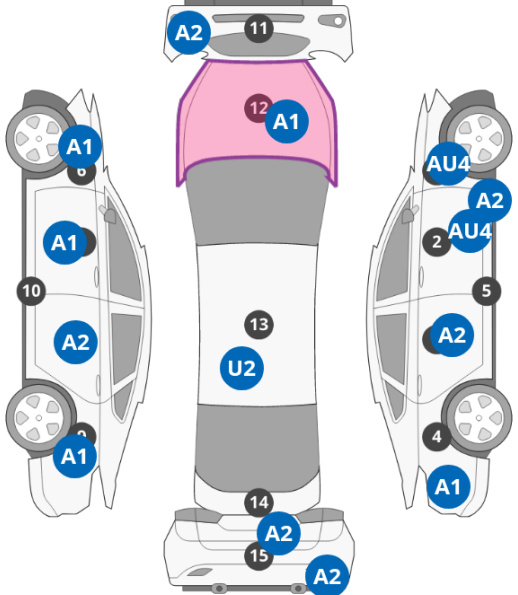
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	138.3	133	101	181
2	Boot Lid	111.0	115	106	112
3	Roof	99.8	101	105	99/94
4	Left Front Fender	101.3	97	103	104
5	Left Front Door	103.6	100	102	109
6	Center Panel Left				
7	Left Rear Door	100.7	106	97	100
8	Left Back Panel	114.6	125	106	113
9	Right Front Fender	109.0	112	111	104
10	Right Front Door	107.3	101	113	108
11	Center Panel Right				
12	Right Rear Door	102.1	101	99	107
13	Right Back Panel	113.3	109	107	124

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>LTO plate not original/No spare tire/No spare key/with jack No tools/with reverse camera/with warranty booklet/front right side door issue/unusual sound engine</p>