

General Information

Date & Time: 07, Jan, 2026 08:36

Make	Toyota	Model	Fortuner
YOM	2025	Odo Meter Reading	27,951
Registration No.	NJC2261	Chassis No.	MHFCB3GS3R0498163
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



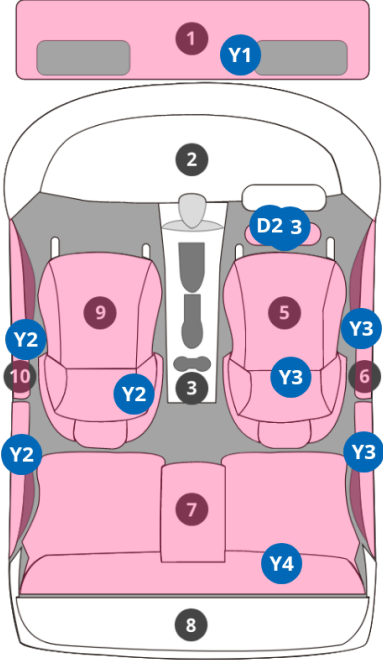
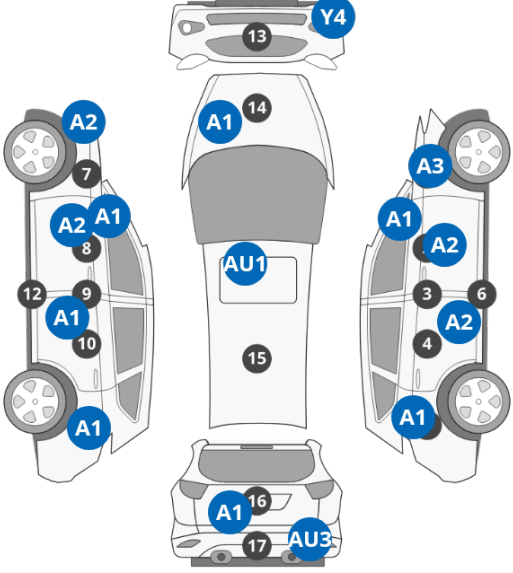
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	116	120	108
2	Boot Lid	97.5	86	114	93
3	Roof	122.2	126	132	123/108
4	Left Front Fender	109.3	108	109	111
5	Left Front Door	102.9	106	99	104
6	Center Panel Left				
7	Left Rear Door	93.8	97	91	93
8	Left Back Panel	97.8	100	102	92
9	Right Front Fender	107.3	117	103	102
10	Right Front Door	105.0	108	105	102
11	Center Panel Right				
12	Right Rear Door	97.5	99	98	95
13	Right Back Panel	113.3	119	110	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Grime - Large / Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Medium / Ceiling - Grime - Minimal / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire and LTO PLATE, scratched and cracked tail light, fog lamp issue</p>