

## General Information

Date & Time: 07, Jan, 2026 11:00

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	5,269
<b>Registration No.</b>	NKP1446	<b>Chassis No.</b>	PA1B18F32S4285628
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



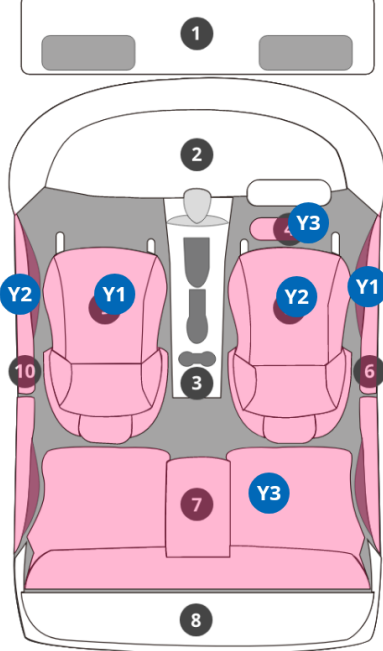
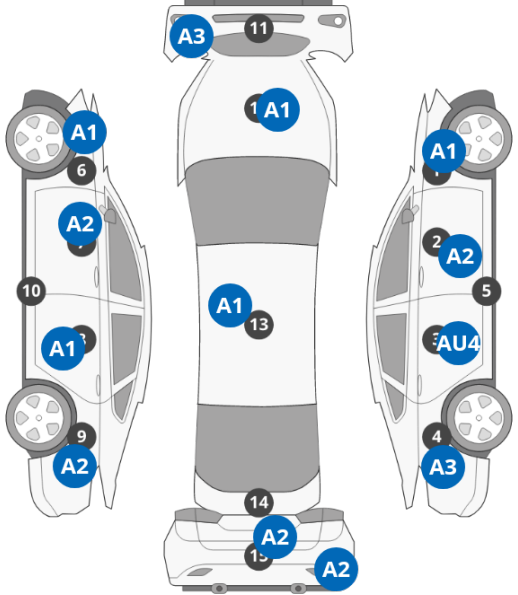
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	117	108	115
2	Boot Lid	104.3	101	103	109
3	Roof	93.9	99	92	88/97
4	Left Front Fender	95.8	95	95	98
5	Left Front Door	99.4	100	97	101
6	Center Panel Left				
7	Left Rear Door	101.3	110	97	97
8	Left Back Panel	105.4	112	105	99
9	Right Front Fender	102.0	103	102	101
10	Right Front Door	92.8	95	90	94
11	Center Panel Right				
12	Right Rear Door	101.3	96	101	107
13	Right Back Panel	98.2	91	95	109

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal</p>	<p><b>Remarks</b> Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/No spare tire/with 2 spare key/with jack No tools/with warranty booklet/with reverse camera</p>