

General Information

Date & Time: 06, Jan, 2026 08:41

Make	Ford	Model	Ranger
YOM	2019	Odo Meter Reading	75,676
Registration No.	CAR5196	Chassis No.	MPBUMFE60KX228625
CC	2.0	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Red		

Body / Panel Condition



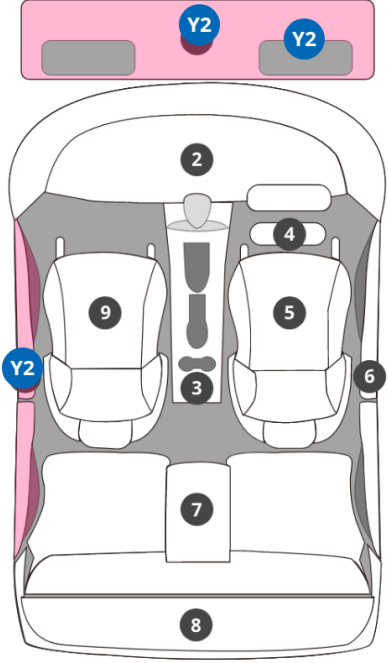
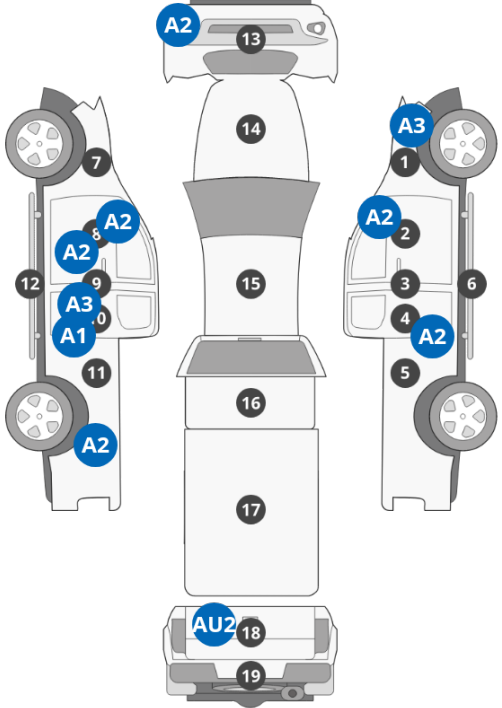
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	141.0	139	146	138
2	Boot Lid	101.0	93	109	101
3	Roof	123.2	134	104	132/123
4	Left Front Fender				
5	Left Front Door	125.3	127	123	126
6	Center Panel Left				
7	Left Rear Door	117.0	120	119	112
8	Left Back Panel	132.0	137	125	134
9	Right Front Fender				
10	Right Front Door	126.6	141	116	123
11	Center Panel Right				
12	Right Rear Door	119.6	123	123	113
13	Right Back Panel	134.6	137	139	128

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Sunvisor, Sunglass Holder - Grime - Small / Ceiling - Grime - Small / (L) Front Trim - Grime - Small</p>	<p>Remarks (R) Mirror - Scratch - Small / (R) Rear Corner Panel - Scratch - Small / Rear Gate - Scratch & Dent - Small / (L) Rear Corner Panel - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (L) Side Gate - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>Interior lights issue. With warranty booklet and spare tire. Without jack and tools. 2 keys. With LTO plate.</p>