

## General Information

Date & Time: 06, Jan, 2026 13:45

<b>Make</b>	Honda	<b>Model</b>	City
<b>YOM</b>	2018	<b>Odo Meter Reading</b>	145,863
<b>Registration No.</b>	NCU2593	<b>Chassis No.</b>	PADGM6620JV412572
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



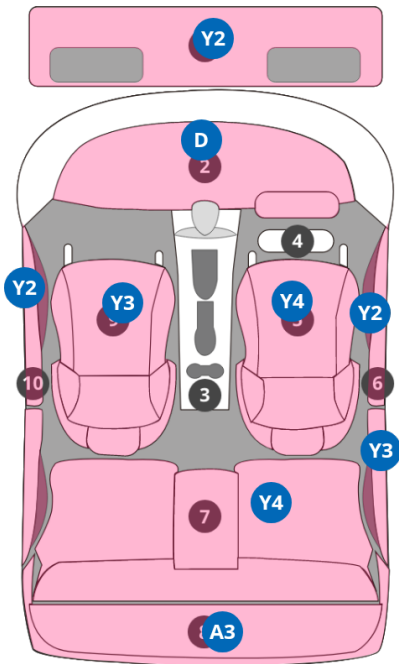
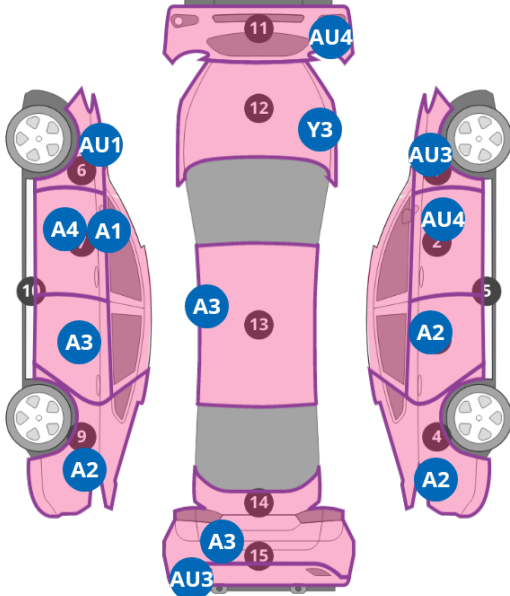
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	330.0	296	340	354
2	Boot Lid	398.6	363	458	375
3	Roof	327.5	342	319	298/351
4	Left Front Fender	316.0	166	461	321
5	Left Front Door	354.6	373	318	373
6	Center Panel Left				
7	Left Rear Door	416.6	482	297	471
8	Left Back Panel	285.6	410	235	212
9	Right Front Fender	409.0	748	251	228
10	Right Front Door	463.0	402	404	583
11	Center Panel Right				
12	Right Rear Door	404.0	389	324	499
13	Right Back Panel	575.3	756	542	428

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	<b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Crack, Gap - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Medium
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

**Inspector Notes**

with LTO plate/with spare tire/No spare key/No jack and tools/No reverse camera/with warranty booklet/tail lights issue/interior dirty