

General Information

Date & Time: 15, Jan, 2026 05:46

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	60,758
Registration No.	FAQ3617	Chassis No.	PA1B18F37P4231491
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



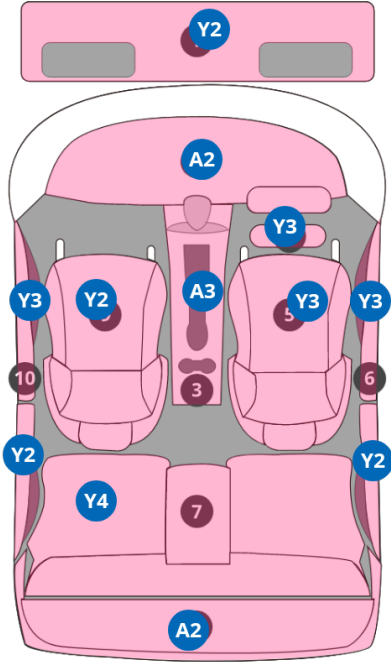
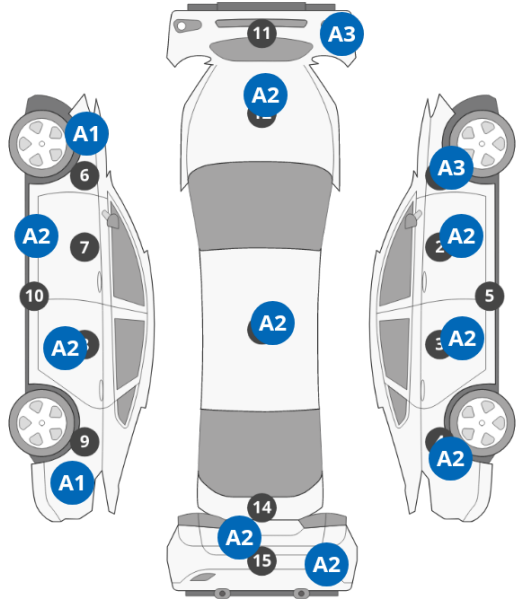
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	107	100	110
2	Boot Lid	93.9	92	91	98
3	Roof	94.9	108	86	100/86
4	Left Front Fender	91.8	90	89	97
5	Left Front Door	101.7	97	99	109
6	Center Panel Left				
7	Left Rear Door	100.9	103	95	105
8	Left Back Panel	102.1	107	100	99
9	Right Front Fender	95.9	98	93	96
10	Right Front Door	94.3	96	93	94
11	Center Panel Right				
12	Right Rear Door	99.7	112	90	97
13	Right Back Panel	98.8	87	94	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Medium / (L) Rear Trim - Grime - Small / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / (R) Front Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small	Remarks (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/No spare key/No spare tire/No reverse camera/with jack and incomplete tools/with seat cover/with warranty booklet