

General Information

Date & Time: 08, Jan, 2026 10:01

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	50,139
Registration No.	NFB2237	Chassis No.	PA1B18F33P4208600
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



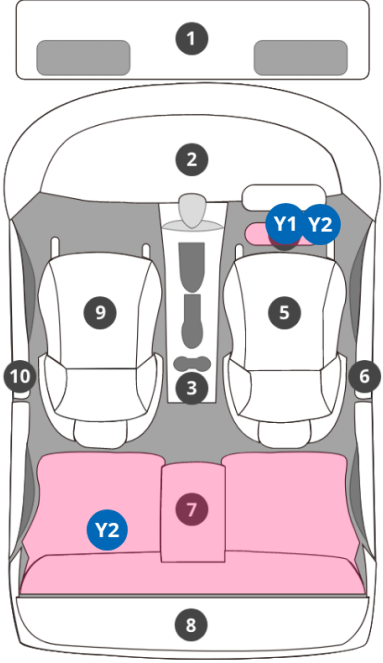
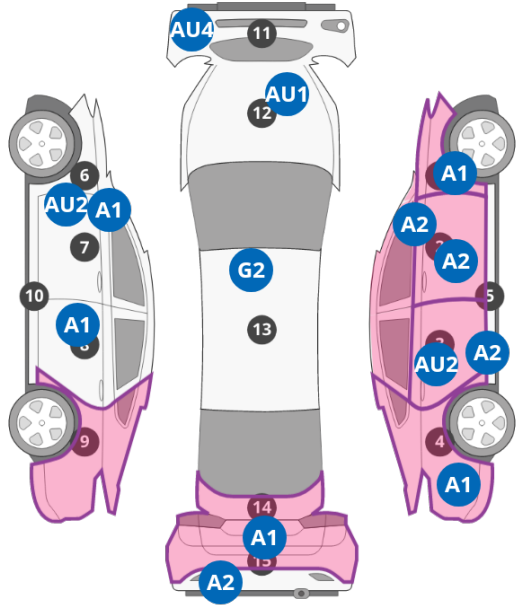
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	112	103	106
2	Boot Lid	147.3	107	129	206
3	Roof	90.9	98	94	82/90
4	Left Front Fender	96.8	97	97	97
5	Left Front Door	95.1	94	96	96
6	Center Panel Left				
7	Left Rear Door	94.9	98	89	99
8	Left Back Panel	131.3	129	151	114
9	Right Front Fender	387.6	181	158	824
10	Right Front Door	139.6	135	131	153
11	Center Panel Right				
12	Right Rear Door	100.3	93	100	108
13	Right Back Panel	102.7	93	102	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Minimal / Front Windshield - Scratch, Stone chip - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights</p>