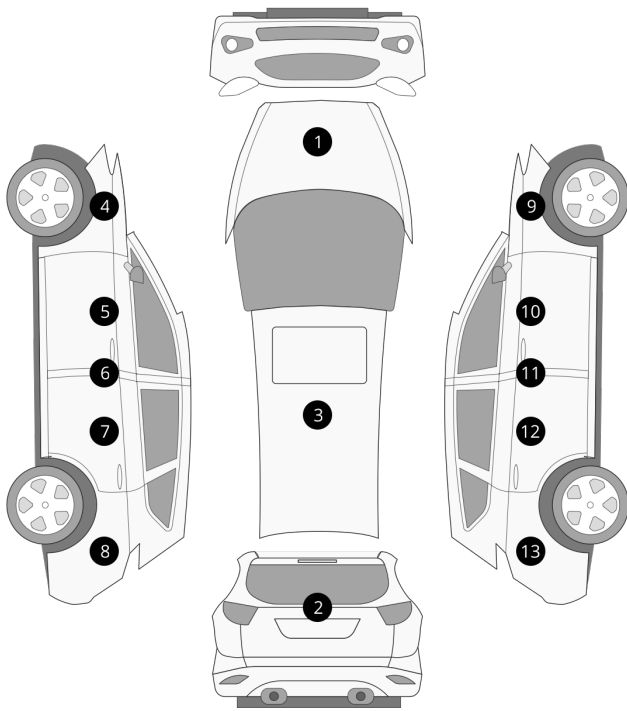


General Information

Date & Time: 09, Jan, 2026 09:07

Make	Mitsubishi	Model	Mirage
YOM	2018	Odo Meter Reading	49,257
Registration No.	NEI1917	Chassis No.	PAEA13TXJJA005542
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



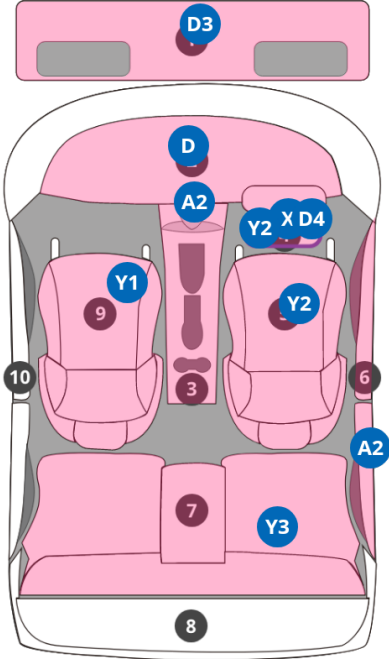
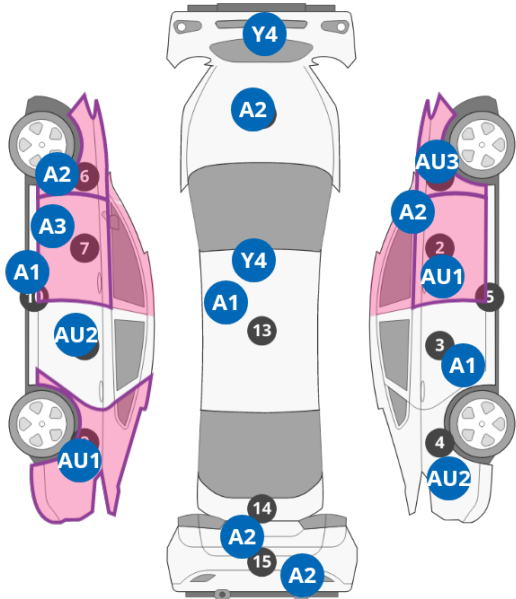
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.3	100	109	98
2	Boot Lid	172.6	181	176	161
3	Roof	77.1	71	67	85/86
4	Left Front Fender	387.3	437	249	476
5	Left Front Door	143.6	165	130	136
6	Center Panel Left				
7	Left Rear Door	142.6	167	129	132
8	Left Back Panel	169.6	185	157	167
9	Right Front Fender	785.3	720	654	982
10	Right Front Door	176.6	173	157	200
11	Center Panel Right				
12	Right Rear Door	142.3	152	128	147
13	Right Back Panel	137.0	140	116	155

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Loose, Deformed - Medium / (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / Mat Other - Missing - Yes / (R) Rear Trim - Cut, Crack - Small / (L) Front Floor Mat - Grime - Small / Carpet - Worked - Large / (L) Front Seat - Grime - Minimal / Knobs - Worn, Peel, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Front Windshield - Damaged - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : C	Functional Evaluation : B
<p>Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on taillights and headlights issue, battery weak</p>