

General Information

Date & Time: 09, Jan, 2026 09:07

Make	Mitsubishi	Model	Mirage
YOM	2024	Odo Meter Reading	21,280
Registration No.	NKJ6000	Chassis No.	PAEA13RJRRRA006726
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



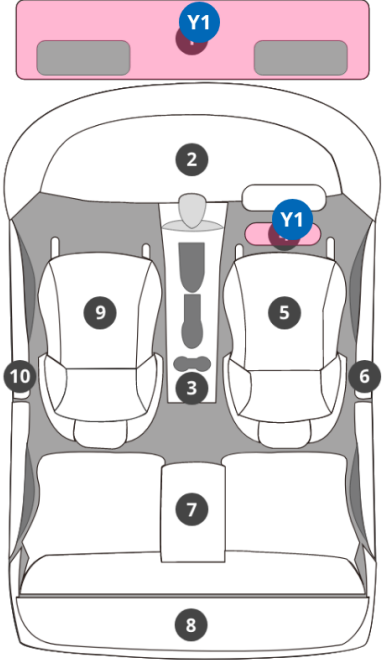
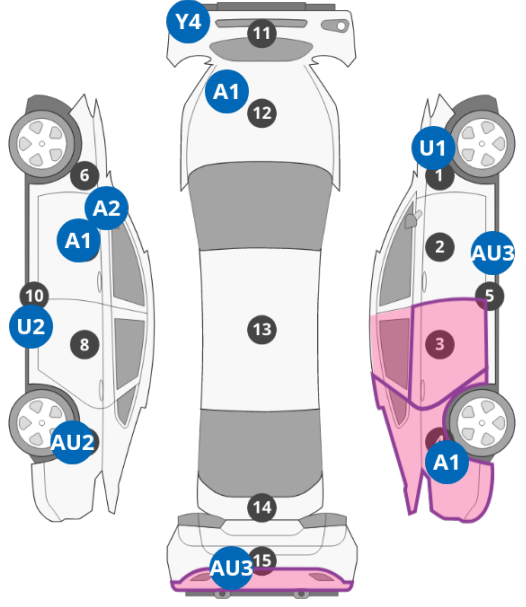
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	120	115	107
2	Boot Lid	102.1	105	106	95
3	Roof	100.5	94	106	96/106
4	Left Front Fender	99.2	99	100	98
5	Left Front Door	99.4	101	101	96
6	Center Panel Left				
7	Left Rear Door	99.7	103	99	97
8	Left Back Panel	112.0	116	114	106
9	Right Front Fender	107.3	114	102	106
10	Right Front Door	109.0	112	106	109
11	Center Panel Right				
12	Right Rear Door	194.6	223	178	183
13	Right Back Panel	187.3	177	163	222

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Minimal / Mat Other - Grime - Minimal	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet, no tools, scratches on headlight and taillight