

General Information

Date & Time: 13, Jan, 2026 16:24

Make	Toyota	Model	Hiace
YOM	2022	Odo Meter Reading	241,075
Registration No.	GAW4248	Chassis No.	JTFNAFAP0M8023522
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Black		

Body / Panel Condition



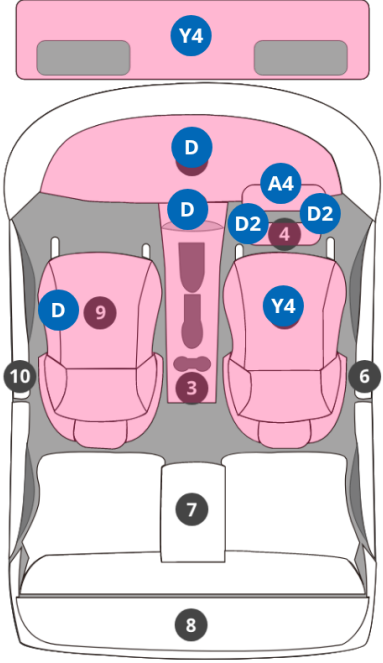
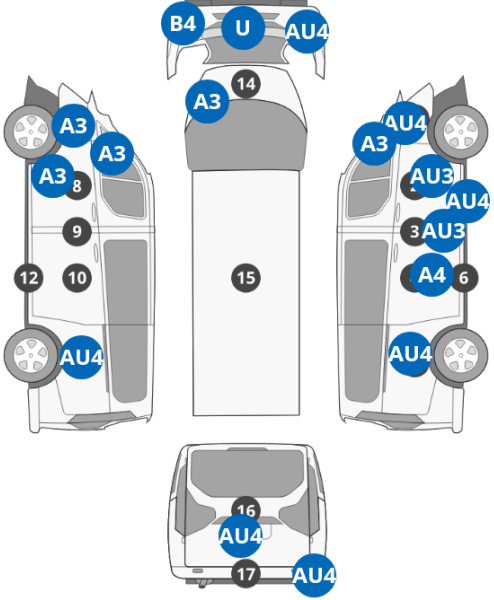
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	212.0	220	202	214
2	Boot Lid	135.3	140	130	136
3	Roof	151.2	124	131	184/166
4	Left Front Fender	162.6	164	175	149
5	Left Front Door	152.0	149	146	161
6	Center Panel Left	174.0	176	170	176
7	Left Rear Door				
8	Left Back Panel	146.6	128	157	155
9	Right Front Fender	244.0	275	238	219
10	Right Front Door	204.0	201	223	188
11	Center Panel Right	171.6	153	175	187
12	Right Rear Door	144.3	147	128	158
13	Right Back Panel	137.6	142	133	138

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Large / (L) Front Seat - Repair Mark - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Overall Interior - Worn as per age - Yes / Steering Wheel - Worn, Peel, Crack - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Medium / Front Bumper, Grille, Lamps - Modified - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Center Panel - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Battery for replacement. Engine oil for replacement. Driving belt unusual sound. Aircon issue. Brake pedal issue. Not advisable to drive the unit due of brakes and underchassis issue. Without warrantybooklet, jack, tools and sest cover. With spare tire but worn. 1 key. With LTO plate.</p>